



<b>DECK</b>			
<b>Condition:</b>	F2 - Fair	<b>Curbs:</b>	I - Inapplicable
<b>Hand Rail:</b>	F2 - Fair	<b>Roadway Condition:</b>	F2 - Fair
<b>Approach Rail:</b>	F2 - Fair		
<b>Comments:</b>	Narrow vertical/pattern cracking with light efflorescence deposits in barrier walls. Wide transverse cracks in sidewalk/curbs and medium pot holes on Route 73. Severe erosion/undermining of material supporting SE/SW rock embedded gutters P3. Wide longitudinal/horizontal cracks in rock gutters. NE/SW hazard markers missing. Light surface corrosion to steel handrails. Wide vertical cracks in caulking at expansion joint gap. Graffiti covering MSE panels.		
<b>HYDROLOGY</b>			
<b>Water Velocity:</b>	n/a m/s	<b>Ice Problem:</b>	NA - Not Applicable
<b>Water Depth:</b>	n/a m	<b>Scour Problem:</b>	NA - Not Applicable
<b>Waterway:</b>	03 - Not Applicable	<b>Debris Problem:</b>	NA - Not Applicable
<b>Comments:</b>			
<b>REPLACEMENT/REHABILITATION</b>			
<b>Next Rehab. Date:</b>	2028	<b>Replacement Year:</b>	2075
<b>Antic. Rehab. Cost:</b>	\$0	<b>Replacement Cost:</b>	\$0
<b>Recommendations:</b>	Repair undermining of rock embedded gutters. Install hazard markers at both exits. Repair/replace pot bearings and apply new protective coating. Install new caulking at expansion joint gaps.		
<b>OBSERVATIONS</b>			
<b>Overall Condition:</b>	P3 - Poor	<b>Requires Further Inspection:</b>	No
<b>Additional Observations:</b>	P3 - Severe corrosion to pot bearings and undermining of material supporting rock embedded gutters.		

Department of Transportation and Infrastructure, Government of Newfoundland and Labrador 2024.