

DECK			
Condition:	F1 - Fair	Curbs:	F1 - Fair
Hand Rail:	P3 - Poor	Roadway Condition:	F1 - Fair
Approach Rail:	P3 - Poor		
Comments:	Previous inspection - Asphalt wearing surface with pothole forming on right side. Curbs have light scaling with some disintegration near expansion joint two and one. Curbs have cracks and spalls at expansion joints. Aluminum bridge rail with concrete end blocks. End blocks have light to medium cracking and impact spalls. No modified end shoe attachments, Guide rail not attached to end block abutment one. Catch basin abutment one right side plugged. Approach rail has rotted and improperly installed posts requiring replacement. Approach 1 on the right has the second bridge rail post missing and third one cracked and severe damage to bridge rail due to impact with bridge rail. Several damaged areas on the left side as well. New inspection - curbs, endblocks & approach guiderail have more deterioration.		
HYDROLOGY			
Water Velocity:	1 m/s	Ice Problem:	N - No Problem
Water Depth:	0.5-1.0 m	Scour Problem:	N - No Problem
Waterway:	01 - Adequate	Debris Problem:	N - No Problem
Comments:	Tidal zone		
REPLACEMENT/REHABILITATION			
Next Rehab. Date:		Replacement Year:	
Antic. Rehab. Cost:	\$tbd	Replacement Cost:	\$tbd
Recommendations:	Clean catch basin. Repair handrail. Repair approach rail. replace expansion joints. Concrete surface repairs including curbs		
OBSERVATIONS			
Overall Condition:	F2 - Fair	Requires Further Inspection:	No
Additional Observations:			