

		GOVERNMENT OF NEWFOUNDLAND AND LABRADOR Department of Transportation and Infrastructure		BRIDGE INSPECTION REPORT B05202025-4	
Date: 5/12/2025		Inspected By: L Christensen		Category: Office - Bridge Office	
BRIDGE INFORMATION					
Site:		4-220 - FEEDER BROOK BRIDGE (NORTH) - R			
SUBSTRUCTURE					
Condition:	P - Poor	Bearings:	U - Uninspectable		
		Bearing Seat:	U - Uninspectable		
Comments:	Bearings and bearing seat covered in debris. Bund walls in poor condition, corroded and leaking material. Replacement required.				
SUPERSTRUCTURE					
Condition:	P3 - Poor	Expansion Joints:	I - Inapplicable		
Comments:	Severe corrosion to stringers in middle of bridge. S3 to S7 have medium to severe corrosion. Small dent in base of outside panel at midspan DS. Timber deck and curb in F1 with some longitudinal splits.				
DECK					
Condition:	F1 - Fair	Curbs:	F1 - Fair		
Hand Rail:	I - Inapplicable	Roadway Condition:	F1 - Fair		
Approach Rail:	P1 - Poor				
Comments:	All timber deck elements in F1 condition. Approach rail damaged - P1 Approach asphalt in poor condition with pot holes before abutment concrete.				
HYDROLOGY					
Water Velocity:	0 m/s	Ice Problem:	N - No Problem		
Water Depth:	0 m	Scour Problem:	N - No Problem		
Waterway:	01 - Adequate	Debris Problem:	N - No Problem		
Comments:					
REPLACEMENT/REHABILITATION					
Next Rehab. Date:	2026	Replacement Year:			
Antic. Rehab. Cost:	\$0	Replacement Cost:	\$0		
Recommendations:					
OBSERVATIONS					
Overall Condition:	P3 - Poor	Requires Further Inspection:	Yes		
Additional Observations:	Closer inspection required on section loss in stringers. Bund walls require replacement.				

Department of Transportation and Infrastructure, Government of Newfoundland and Labrador 2026.