

		GOVERNMENT OF NEWFOUNDLAND AND LABRADOR Department of Transportation and Infrastructure		BRIDGE INSPECTION REPORT B09082025-5	
Date: 9/2/2025		Inspected By: Megan/Heidi		Category: Office - Bridge Office	
BRIDGE INFORMATION					
Site:		4-005 - HARRY'S RIVER BRIDGE - R			
SUBSTRUCTURE					
Condition:	F1 - Fair	Bearings:	G - Good		
		Bearing Seat:	G - Good		
Comments:	Erosion, concrete disintegration and medium to wide cracks, as well as cracks with efflorescence in abutment #1. Medium scaling some wide cracks and spalls in abutment #2. Disintegration, cracks with efflorescence, medium to hairline cracking and honey combing noted in wingwalls.				
SUPERSTRUCTURE					
Condition:	G - Good	Expansion Joints:	F1 - Fair		
Comments:	Suspected leak at joints.				
DECK					
Condition:	F2 - Fair	Curbs:	G - Good		
Hand Rail:	G - Good	Roadway Condition:	F2 - Fair		
Approach Rail:	F1 - Fair				
Comments:	Deck/ interior and end soffit in excellent condition. Some low cover spalls and rust staining in exterior soffit. Handrail in excellent condition. Wearing surface good condition. Approach rail has rotten timber posts and some abrasion. Potholes and wide cracks noted in approach wearing surface.				
HYDROLOGY					
Water Velocity:	0 m/s	Ice Problem:	NA - Not Applicable		
Water Depth:	0 m	Scour Problem:	NA - Not Applicable		
Waterway:	01 - Adequate	Debris Problem:	NA - Not Applicable		
Comments:	N/A				
REPLACEMENT/REHABILITATION					
Next Rehab. Date:		Replacement Year:			
Antic. Rehab. Cost:	\$0	Replacement Cost:	\$0		
Recommendations:	Consider repairs to approach rail, repair of potholes and wide cracks in approach.				
OBSERVATIONS					
Overall Condition:	F2 - Fair	Requires Further Inspection:	No		
Additional Observations:	Refer to BMS for a detailed OSIM inspection. Salmon river.				

Department of Transportation and Infrastructure, Government of Newfoundland and Labrador 2026.