

# Real-Time Water Quality Report

## Outer Cove Brook Network

Deployment Period  
March 5, 2015 to April 14, 2015



Government of Newfoundland & Labrador  
Department of Environment and Conservation  
Water Resources Management Division

Prepared by:

Tara Clinton  
Environmental Scientist  
Water Resources Management Division  
Department of Environment & Conservation  
4th Floor, Confederation Building, West Block  
PO Box 8700, St. John's NL A1B 4J6  
Ph. No.: (709) 729 - 5925  
Fax No.: (709) 729 - 0320  
[taracClinton@gov.nl.ca](mailto:taracClinton@gov.nl.ca)

## General

The Water Resources Management Division (WRMD), in partnership with the City of St. John's and Environment Canada, maintain two real-time water quality and water quantity monitoring stations along Outer Cove Brook.

This deployment report discusses water quality related events occurring at the stations: Outer Cove Brook below Airport and Outer Cove Brook at Clovelly Golf Course in St. John's.

WRMD staff monitors the real-time web pages regularly. The City of St. John's will be notified of any water quality issues that arise so mitigated measures can be taken.

The purpose of these real-time stations is to monitor, process and publish real-time water quality data at the real-time stations. Outer Cove Brook is in the vicinity of the Torbay Road North Commercial Development Area and the real-time stations allow for assessment and management of the water body.

This report covers the deployment period of March 5, 2015 until removal on April 14, 2015.

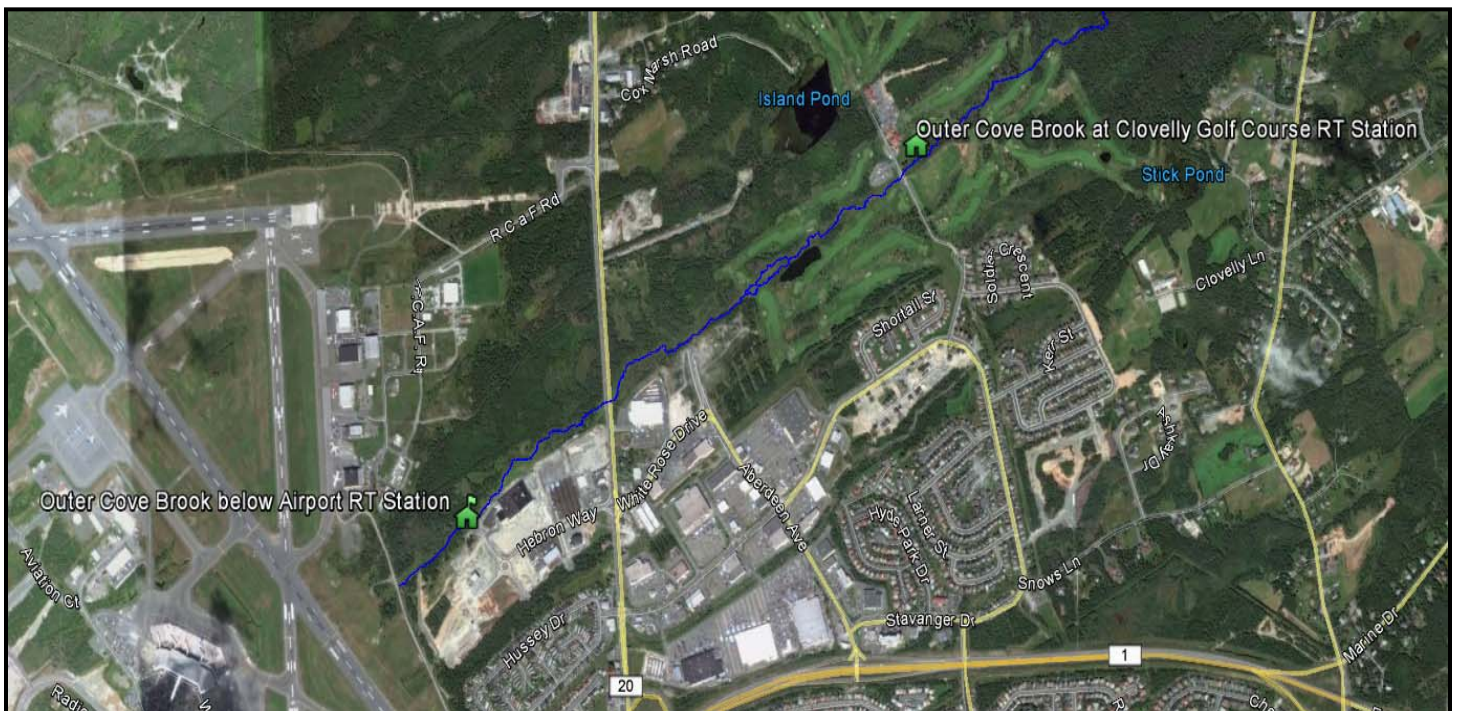


Figure 1: Outer Cove Brook Real-Time Water Quality and Quantity Stations.

## Quality Assurance and Quality Control

As part of the Quality Assurance and Quality Control protocol (QA/QC), an assessment of the reliability of data recorded by an instrument is made at the beginning and end of the deployment period. The procedure is based on the approach used by the United States Geological Survey.

At deployment and removal, a QA/QC Sonde is temporarily deployed alongside the Field Sonde. Values for temperature, pH, conductivity, dissolved oxygen and turbidity are compared between the two instruments.

Based on the degree of difference between the parameters on the Field Sonde and QA/QC Sonde at deployment and at removal, a qualitative statement is made on the data quality (Table 1).

Water Resources Management (WRMD) staff (Environment and Conservation (ENVC)) is responsible for maintenance of the real-time water quality monitoring equipment, as well as recording and managing the water quality data. Tara Clinton, under the supervision of Renee Paterson, is ENVC's main contact for the real-time water quality monitoring operations at Outer Cove Brook, and is responsible for maintaining and calibrating water quality instruments, as well as grooming, analyzing and reporting on water quality data recorded at the stations during the deployment year.

Water Survey of Canada (WSC) staff (Environment Canada (EC)) under the management of Howie Wills, play an essential role in the data logging/communication aspect of the network and the maintenance of the water quantity monitoring equipment. EC-WSC staff visit the sites regularly to ensure the data logging and data transmitting equipment are working properly. WSC is responsible for handling stage and streamflow issues. The quantity data is raw data that is transmitted via satellite and published online with the quality data on the Real-Time Stations website. Quantity data has not been corrected or groomed when published online or used in the monthly reports for the stations. WSC is responsible for QA/QC of water quantity data. Corrected stage and streamflow data can be obtained upon request to WSC.

**Table 1: Instrument Performance Ranking classifications for deployment and removal**

	Rank				
Parameter	Excellent	Good	Fair	Marginal	Poor
Temperature (°C)	$\leq \pm 0.2$	$> \pm 0.2$ to 0.5	$> \pm 0.5$ to 0.8	$> \pm 0.8$ to 1	$< \pm 1$
pH (unit)	$\leq \pm 0.2$	$> \pm 0.2$ to 0.5	$> \pm 0.5$ to 0.8	$> \pm 0.8$ to 1	$> \pm 1$
Sp. Conductance ( $\mu\text{S}/\text{cm}$ )	$\leq \pm 3$	$> \pm 3$ to 10	$> \pm 10$ to 15	$> \pm 15$ to 20	$> \pm 20$
Sp. Conductance $> 35 \mu\text{S}/\text{cm}$ (%)	$\leq \pm 3$	$> \pm 3$ to 10	$> \pm 10$ to 15	$> \pm 15$ to 20	$> \pm 20$
Dissolved Oxygen (mg/L) (% Sat)	$\leq \pm 0.3$	$> \pm 0.3$ to 0.5	$> \pm 0.5$ to 0.8	$> \pm 0.8$ to 1	$> \pm 1$
Turbidity $< 40$ NTU (NTU)	$\leq \pm 2$	$> \pm 2$ to 5	$> \pm 5$ to 8	$> \pm 8$ to 10	$> \pm 10$
Turbidity $> 40$ NTU (%)	$\leq \pm 5$	$> \pm 5$ to 10	$> \pm 10$ to 15	$> \pm 15$ to 20	$> \pm 20$

It should be noted that the temperature sensor on any sonde is the most important. All other parameters can be divided into subgroups of: temperature dependant, temperature compensated and temperature independent. Due to the temperature sensor's location on the sonde, the entire sonde must be at a constant temperature before the temperature sensor will stabilize. The values may take some time to climb to the appropriate reading; if a reading is taken too soon it may not accurately portray the water body.

#### **Concerns or Issues during the deployment period**

Aside from several spotty data periods during the beginning of the deployment period, there were no outstanding issues or problems at these stations during deployment.

Deployment and removal instrument performance rankings for **Outer Cove Brook below Airport** are summarized in Table 2.

**Table 2: Instrument performance rankings for Outer Cove Brook below Airport**

Station	Date	Action	Comparison Ranking				
			Temperature	pH	Conductivity	Dissolved Oxygen	Turbidity
Below Airport	March 5	Deployment	Excellent	Good	Excellent	Excellent	Excellent
	April 14	Removal	Excellent	Excellent	Marginal	Poor	Excellent

- During the Outer Cove Brook below Airport station deployment, the water quality parameter data ranked as 'Excellent' or 'Good'.
- At removal of the instrument, the water temperature and pH data and turbidity ranked as 'Excellent', with conductivity data ranking as 'Marginal'. The dissolved oxygen data ranked as 'Poor' which may have been a result of the fouling present on the sensors at the time of removal. At removal the instrument and the instrument protective casing was covered with a slime-like substance.

Deployment and removal instrument performance rankings for **Outer Cove Brook at Clovelly Golf Course** are summarized in Table 3.

**Table 3: Instrument performance rankings for Outer Cove Brook at Clovelly Golf Course**

Station	Date	Action	Comparison Ranking				
			Temperature	pH	Conductivity	Dissolved Oxygen	Turbidity
Clovelly Golf Course	March 5	Deployment	Excellent	Excellent	Excellent	Fair	Excellent
	April 14	Removal	Excellent	Excellent	Excellent	Excellent	Poor

- Comparison of the field sonde and QAQC data during the deployment at Outer Cove Brook Clovelly Golf Course indicated the following: water temperature, pH, conductivity and turbidity comparison data all ranked as 'excellent'. Dissolved Oxygen data ranked as 'Fair' during initial deployment.
- At removal the comparison between the field sonde and QAQC sonde indicated that, water temperature, pH, conductivity and dissolved oxygen data ranked as 'Excellent', while the data for turbidity ranked as 'Poor'. At the time of removal the instrument was experiencing some biofouling by slime like substance. It is likely the fouling had built up around the turbidity sensor. This inference can cause the data to rank poorly.



## Outer Cove Brook below Airport

### Water Temperature

Water temperature ranged from  $-0.10^{\circ}\text{C}$  to  $5.30^{\circ}\text{C}$  during this deployment period (Figure 2). There were noticeable increases and decreases in the water temperature during this deployment period. This is consistent with ambient air temperatures over this time period, generally increasing during daylight hours and cooling overnight.

The water temperatures at this station do display diurnal variations although slightly exaggerated due to the climatic conditions during this deployment period. Shallow streams and ponds are highly influenced by natural diurnal variations in the surrounding air temperatures and precipitation events (Appendix I).

As the deployment period came to an end, the water temperature starts to increase overall. The spikes displayed by stage level was likely a result of ice buildup or freezing over of the brook. Please note, the stage data is raw data that is published on our web page. It has not been corrected for backwater effect. WSC is responsible for QA/QC of water quantity data. Corrected data can be obtained upon request to WSC.

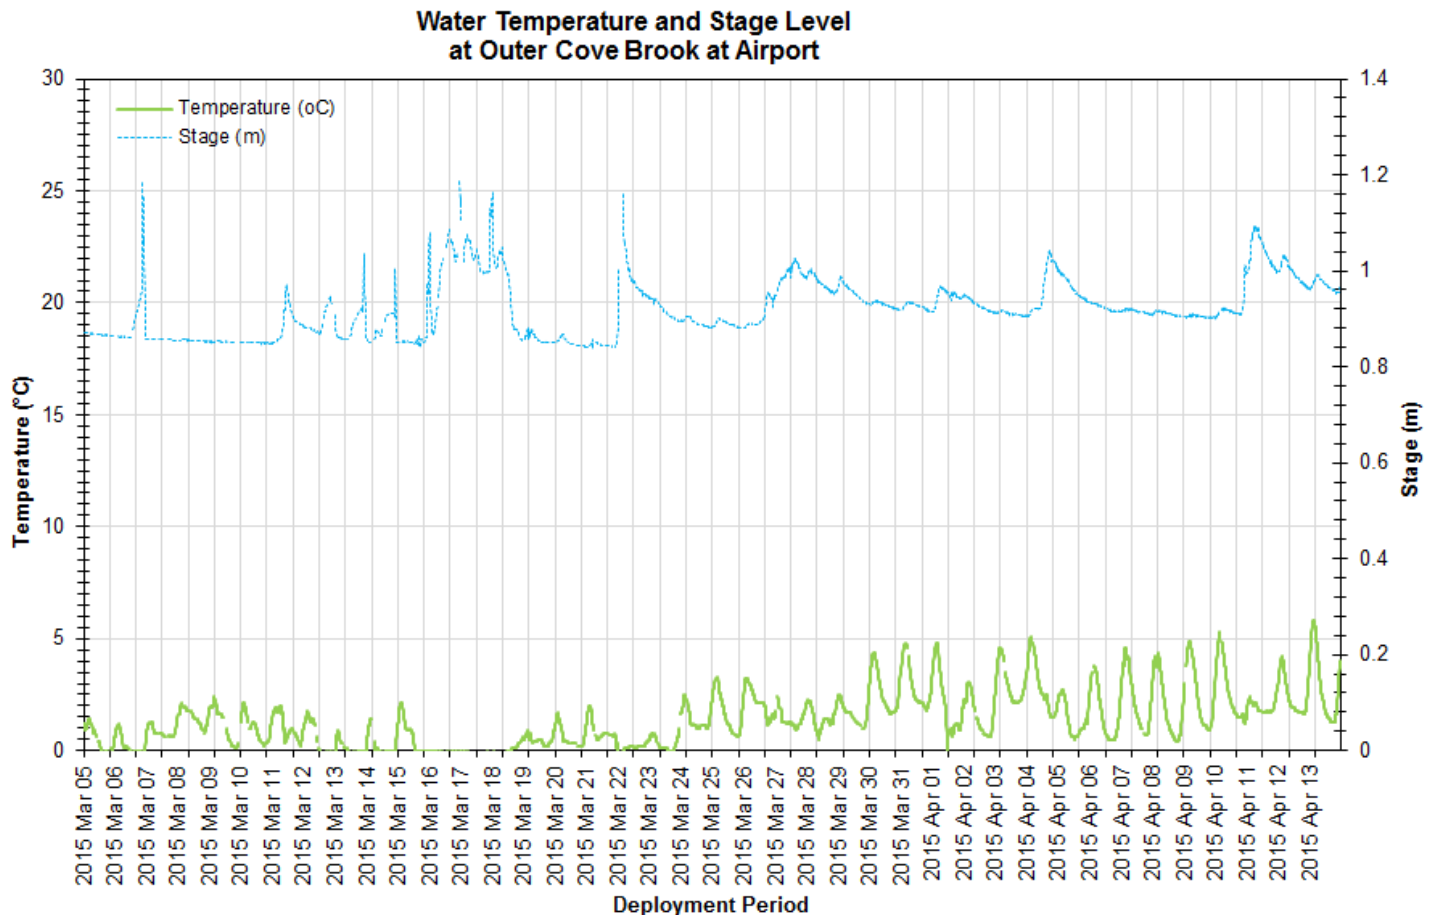


Figure 2: Water temperature ( $^{\circ}\text{C}$ ) and Stage (m) values at Outer Cove Brook below Airport

## pH

Throughout the deployment period, pH values ranged between 6.69 pH units and 7.65 pH units (Figure 3).

During this deployment, all pH values at this station were within the CCME Guidelines for the Protection of Aquatic Life (6.5 pH units and 9.0 pH units).

All increases in pH corresponded with increases in stage level for similar time frames. During the deployment period the increased stage levels caused a sharp increase and then decrease in pH values. The CCME guideline provides a basis by which to judge the overall health of the brook. Naturally, all streams and brooks are different. During the deployment period the median pH level was 7.02 pH units.

Please note the stage data is raw data that is published on our web page. It has not been corrected for backwater effect. WSC is responsible for QA/QC of water quantity data. Corrected data can be obtained upon request to WSC.

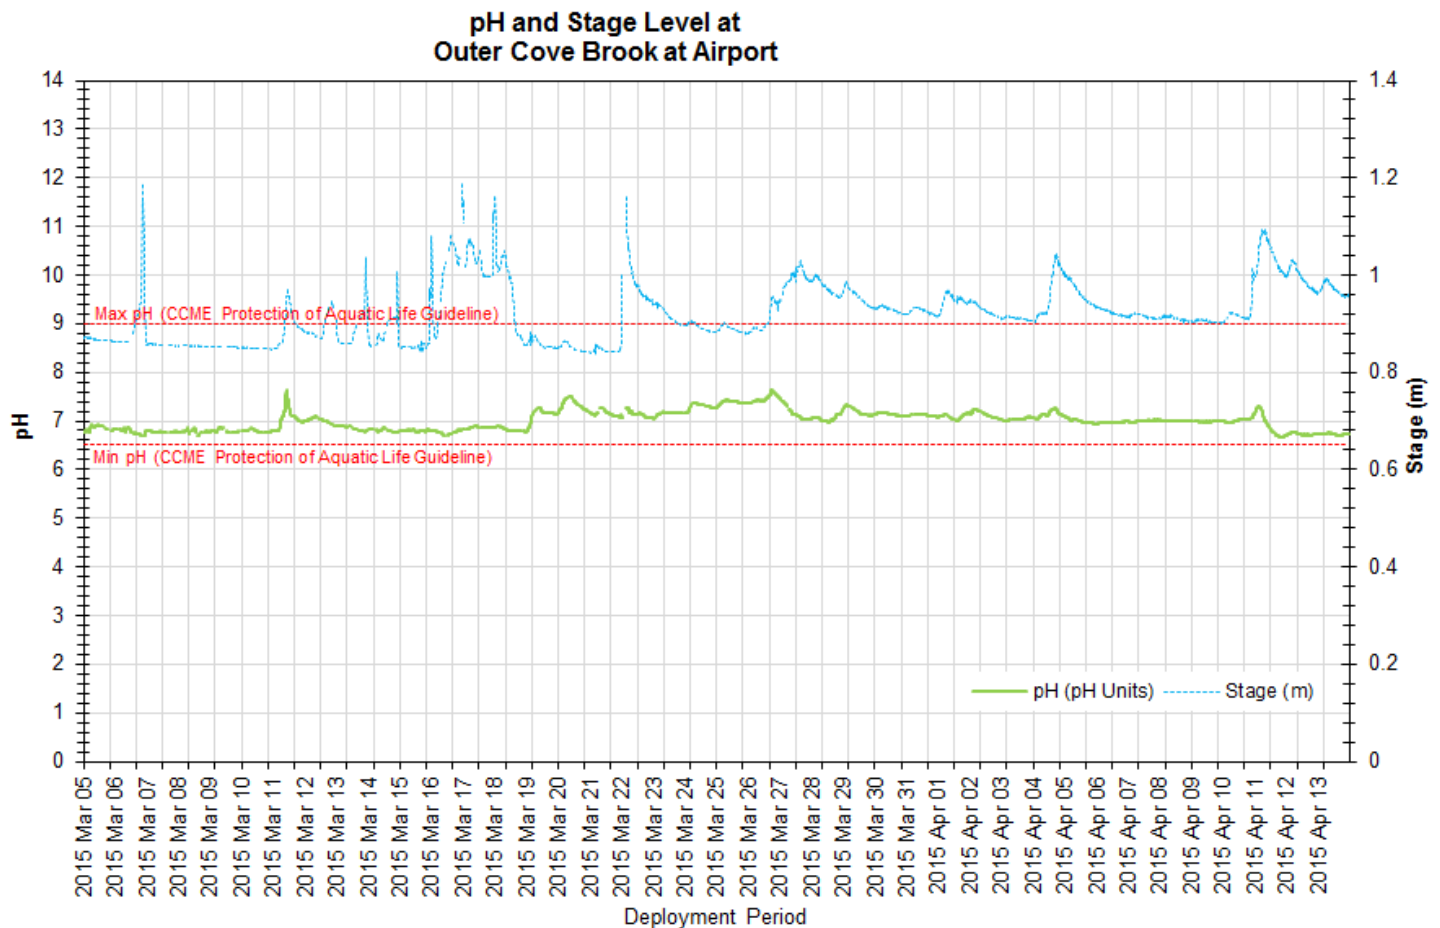


Figure 3: pH (pH units) and stage level (m) values at Outer Cove Brook below Airport


### Specific Conductivity

The conductivity levels were within 424  $\mu\text{S}/\text{cm}$  and 2539  $\mu\text{S}/\text{cm}$  during this deployment period.

Commonly the relationship between conductivity and stage level is inverted. When stage levels rise, the specific conductance levels drop in response as the increased amount of water in the river system dilutes the solids that are present. This was not the case during this deployment period.

The conductivity values that peaked together with stage levels were likely a result of road salt making its way into the brook after/during rainfall.  $0^{\circ}\text{C}$  or below  $0^{\circ}\text{C}$  air temperatures (Appendix I) create frosty and icy road conditions, therefore the roadways are salted and the conductivity levels increase as the residual salt is flushed into the brook through rainfall/runoff.

The dips in conductivity data after increases in stage indicate that the brook is being flushed naturally, the suspended matter and dissolved substances in the brook are flushed for a short period of time with the higher flow. This is evident on April 5<sup>th</sup> and April 11<sup>th</sup>, 2015.

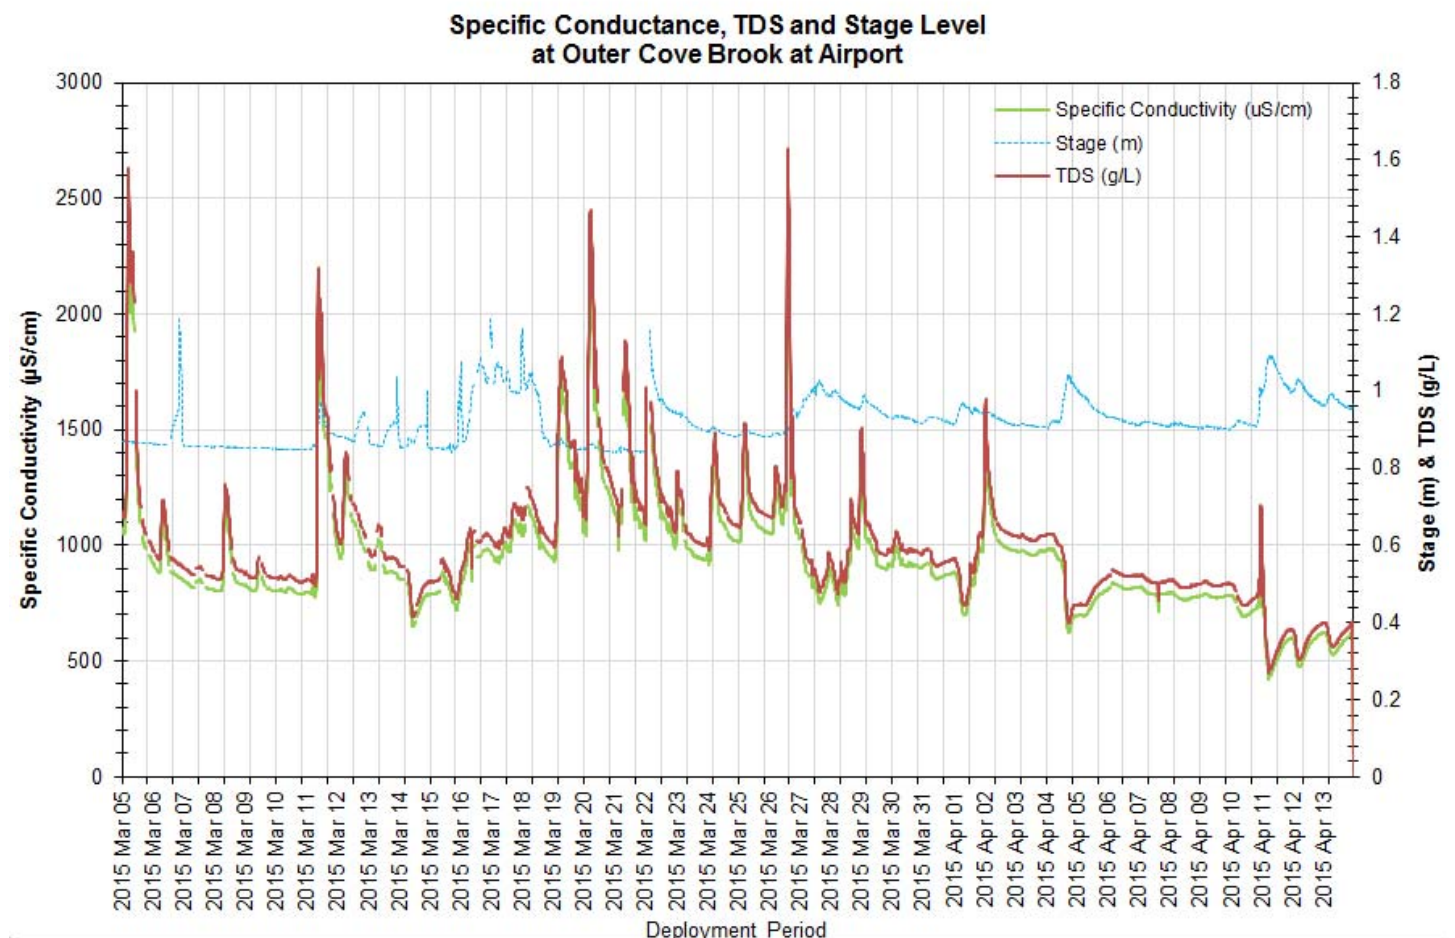

**Figure 4: Specific conductivity ( $\mu\text{S}/\text{cm}$ ) and stage (m) values at Outer Cove Brook below Airport.**



## Dissolved Oxygen

The water quality instrument measures dissolved oxygen (mg/L) with the dissolved oxygen probe and then the instrument calculates percent saturation (% Sat) with water temperature.

The Dissolved Oxygen % Sat levels were within 63.8 %Sat to 84.8 %Sat. Dissolved Oxygen (mg/L) measured 9.06 mg/L to 12.22 mg/L (Figure 5).

During the deployment the dissolved oxygen levels were reasonably consistent. There was an evident relationship between water temperature and dissolved oxygen. As water temperature decreased the level of dissolved oxygen consumed decreased, which means there is slightly more dissolved oxygen in the brook during the cooler temperatures.

There is dip in dissolved oxygen around March 15<sup>th</sup> to March 19<sup>th</sup>. It is not clear why the dissolved oxygen was low at that time. The dissolved oxygen levels do return to more normal levels after March 19<sup>th</sup>. During this time frame there was also 0°C or below 0°C water temperatures recorded.

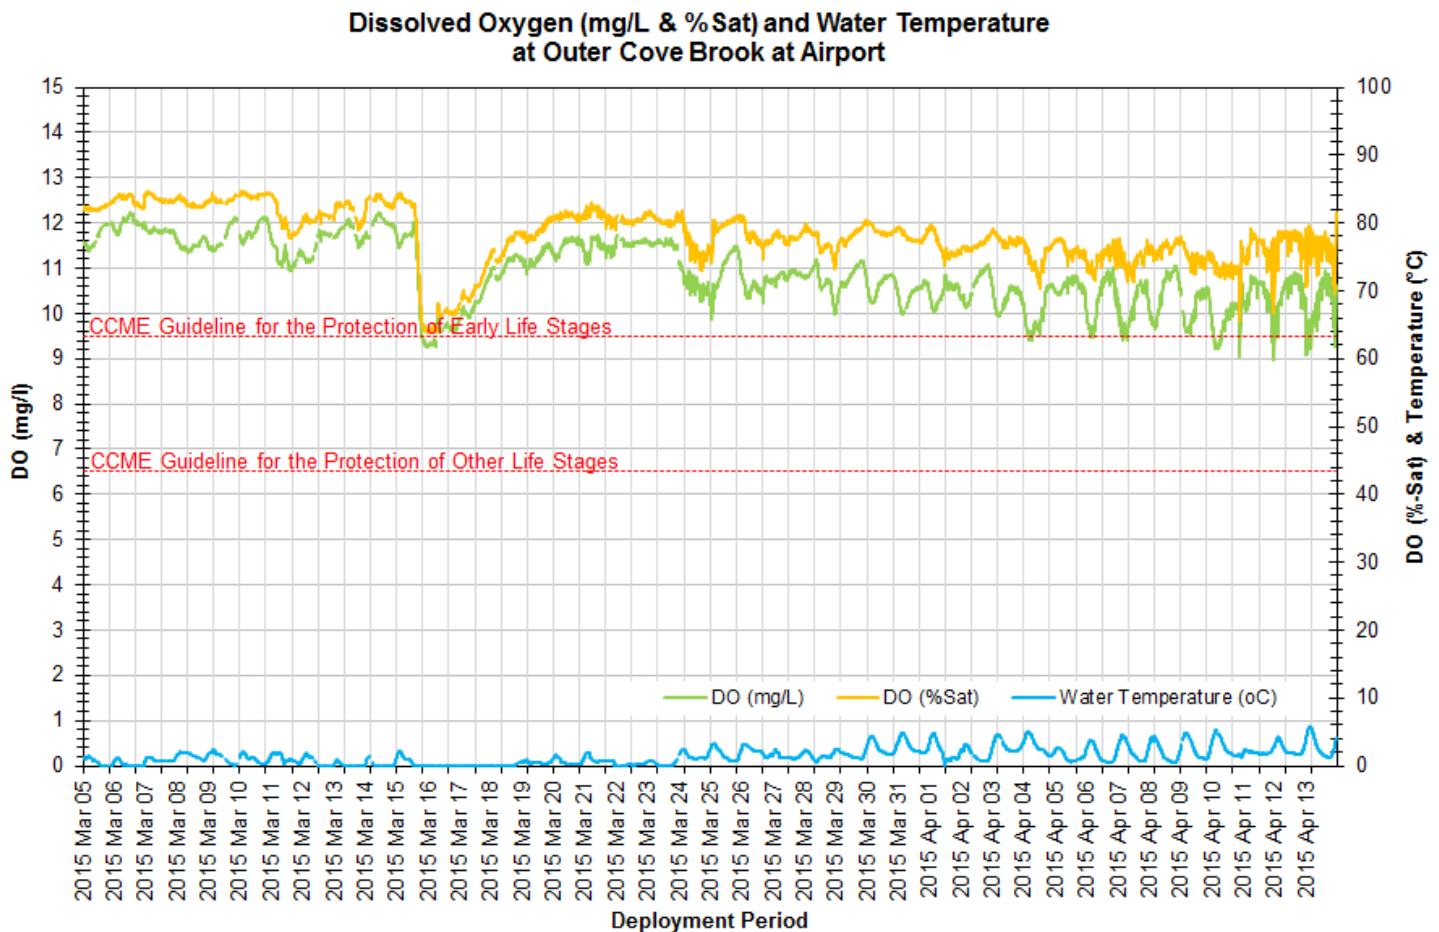



Figure 5: Dissolved oxygen (mg/L & % sat) and water temperature (°C) values at Outer Cove Brook below Airport.

## Turbidity

Turbidity levels during the deployment ranged within 0.0 NTU and 770.0 NTU (Figure 6). The deployment data had a median of 1.1 NTU.

The turbidity sensor on this instrument can read turbidity values between 0 NTU and 3000 NTU. However a turbidity reading of 3000 NTU is always identified as an error reading and should not be used as a valid reading or included in any statistical analysis.

Most of the turbidity events in the deployment period correlate with increases in stage potentially from precipitation (Figure 6). Precipitation (Appendix I) can increase the presence of suspended material in water. The large turbidity event on March 28<sup>th</sup> corresponds with a slight stage increase at that time. The turbidity data stabilizes within the same day. The turbidity peaks from April 11<sup>th</sup> to April 13<sup>th</sup> are also a result of increases in stage level due to increase precipitation.

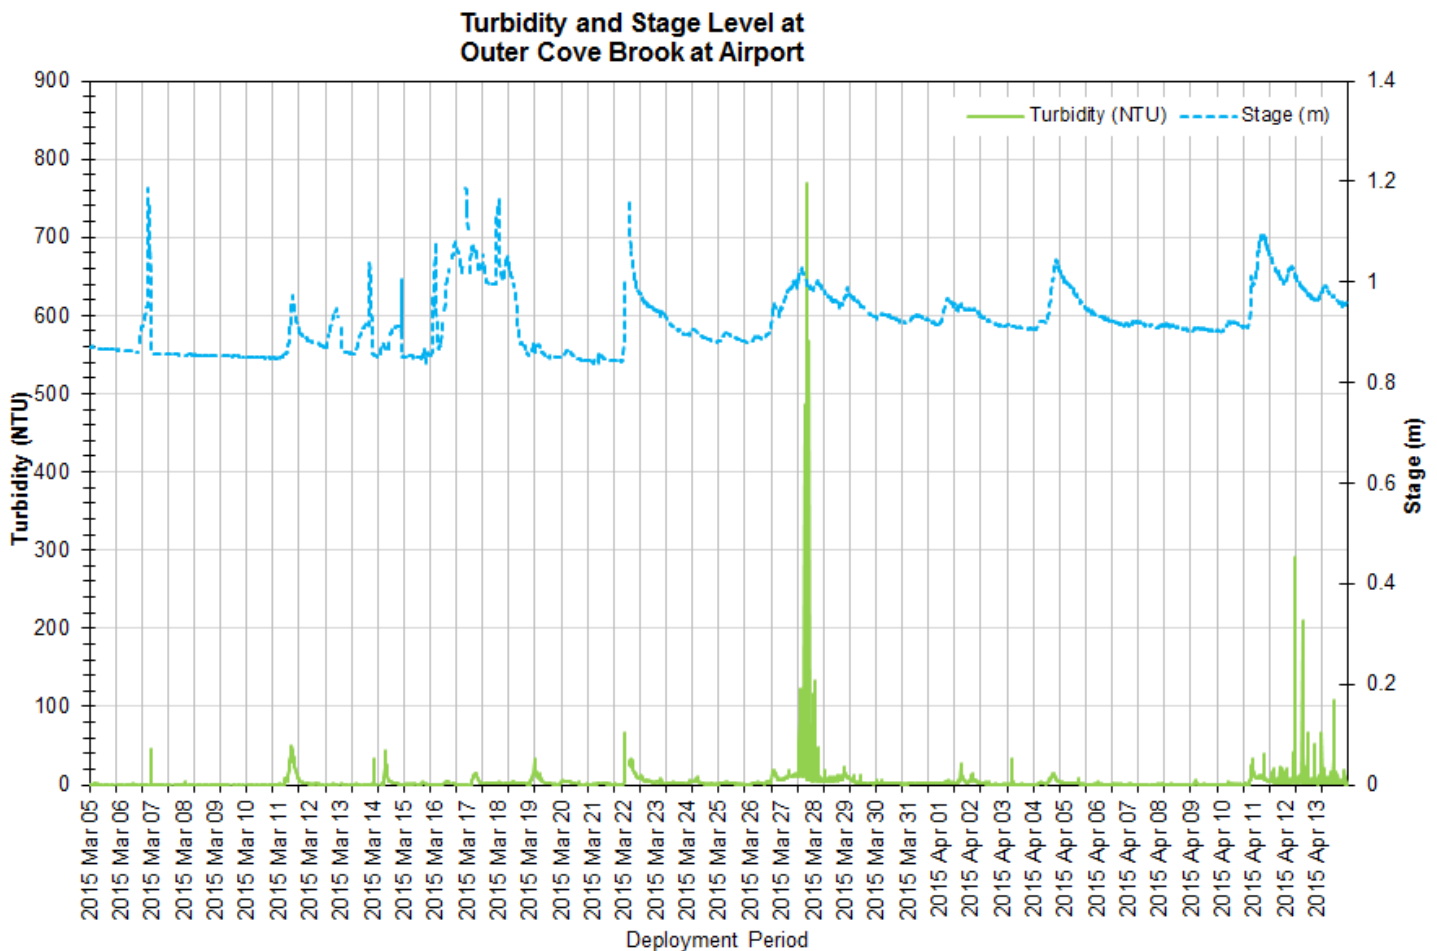

**Figure 6: Turbidity (NTU) and stage level (m) values at Outer Cove Brook below Airport.**


### Stage, Stream Flow & Precipitation

Stage can be defined as the height or elevation of the stream's water surface above a reference elevation (sea level, gage level). Stage is important to display as it provides an estimation of water level at the station and can explain some of the events that are occurring with other parameters (i.e. Specific Conductivity, DO, turbidity).

During the deployment period, the daily averaged stage data ranged from 0.84m to 1.19m. The larger peaks in stage do correspond with substantial rainfall events as noted on Figure 7.

Precipitation data was obtained from Environment Canada's St. John's Airport weather station. Precipitation ranges for the deployment period were a minimum of 0.0 mm and a maximum of 28.2 mm on March 16<sup>th</sup> which increased both stage and streamflow at that time.

Please note the stage data graphed below is raw data that is published on WRMD web page. It has not been corrected for backwater effect. WSC is responsible for QA/QC of water quantity data. Corrected data can be obtained upon request to WSC.

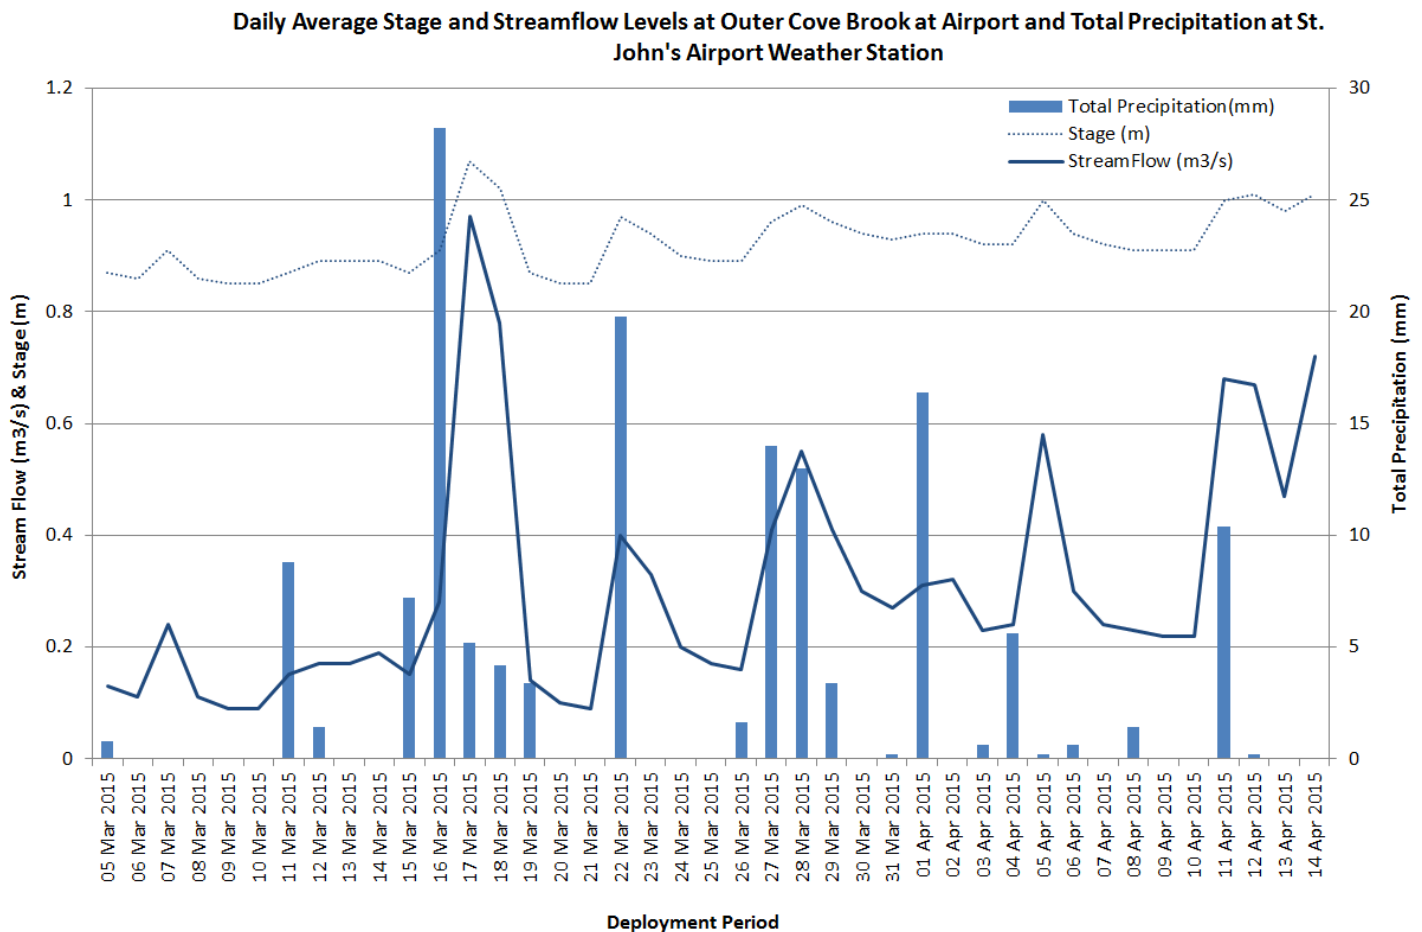

**Figure 7: Daily average stage & stream flow values at Outer Cove Brook below Airport and daily total precipitation values from Environment Canada's St. John's Airport Station.**

## **Conclusion**

As with many shallow brooks and streams, precipitation events play a role in influencing the parameters within the water body. Outer Cove Brook at Airport flows through significant developed areas, including residential zones and within the boundaries of heavily used road ways, which can influence the parameter levels that are recorded.

At the station an influx of rainfall increased conductivity due to the dissolved salts from road salting being flushed into the brook. Rainfall also contributed to an increase in turbidity in the brook for short periods of time. pH values increased (alkalinity increased) after runoff from the surrounding environment flushed dissolved substances into the water column. The pH data is likely a combination of rainfall and road salting during the below 0°C temperatures (Appendix I).

The cooler ambient air temperatures (Appendix I) influenced the water temperature during this deployment period. In turn, water temperature directly affects the amount of dissolved oxygen present in the brook and it is common to see mirroring trends in dissolved oxygen.

The turbidity spikes mirror peaks in conductivity and pH occurring around the same dates. This can indicate that the turbidity in the brook was likely another factor from the road salting during these time frames.

## Outer Cove Brook at Clovelly Golf Course


### Water Temperature

Water temperature ranged from  $-0.10^{\circ}\text{C}$  to  $6.52^{\circ}\text{C}$  during this deployment period (Figure 8).

During this deployment period the water temperature remains reasonably consistent until the middle of March. Water temperatures are still cooler into the middle of March. As the deployment period ends the water temperatures have increased, along with the air temperatures for this time of year. There is a more defined diurnal and exaggerated pattern in the water temperature into April.

Water temperature on these water quality instruments is a very important parameter and it has the ability to influence other parameters.

Stage data displays several large spikes which could be ice on the brook interfering with the stage instruments ability to read the elevation. Please note the stage data graphed below is raw data that is published on WRMD web page. It has not been corrected for backwater effect. WSC is responsible for QA/QC of water quantity data. Corrected data can be obtained upon request to WSC.

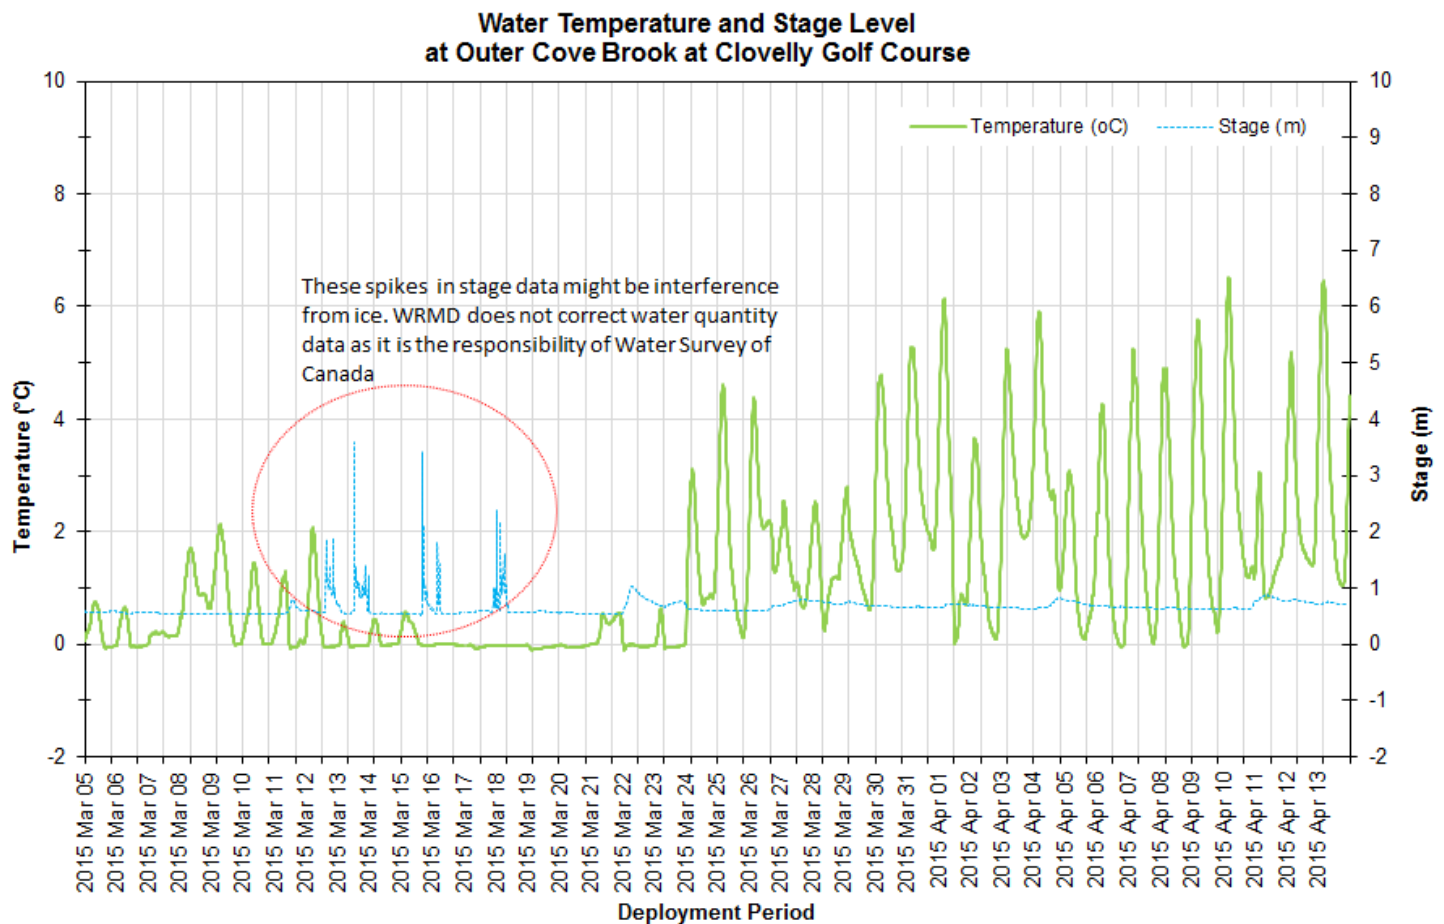

**Figure 8: Water temperature ( $^{\circ}\text{C}$ ) and Stage (m) levels at Outer Cove Brook at Clovelly Golf Course.**



## pH


Throughout this deployment period pH values ranged between 6.47 pH units and 7.31 pH units (Figure 9).

During the deployment, the majority of the pH values at this station recorded within the minimum and maximum CCME Guideline for the Protection of Aquatic Life.

The pH data that did dip below the minimum guideline corresponded with increases in stage level. Increases in stage resulted in increases and then sharp decreases in pH values.

The CCME guideline provides a basis by which to judge the overall health of the brook. Naturally, all streams and brooks are different. During this deployment period the median pH level was 6.85 units (a slightly higher pH median from last deployment).

Please note the stage data graphed below is raw data that is published on WRMD web page. It has not been corrected for backwater effect. WSC is responsible for QA/QC of water quantity data. Corrected data can be obtained upon request to WSC.

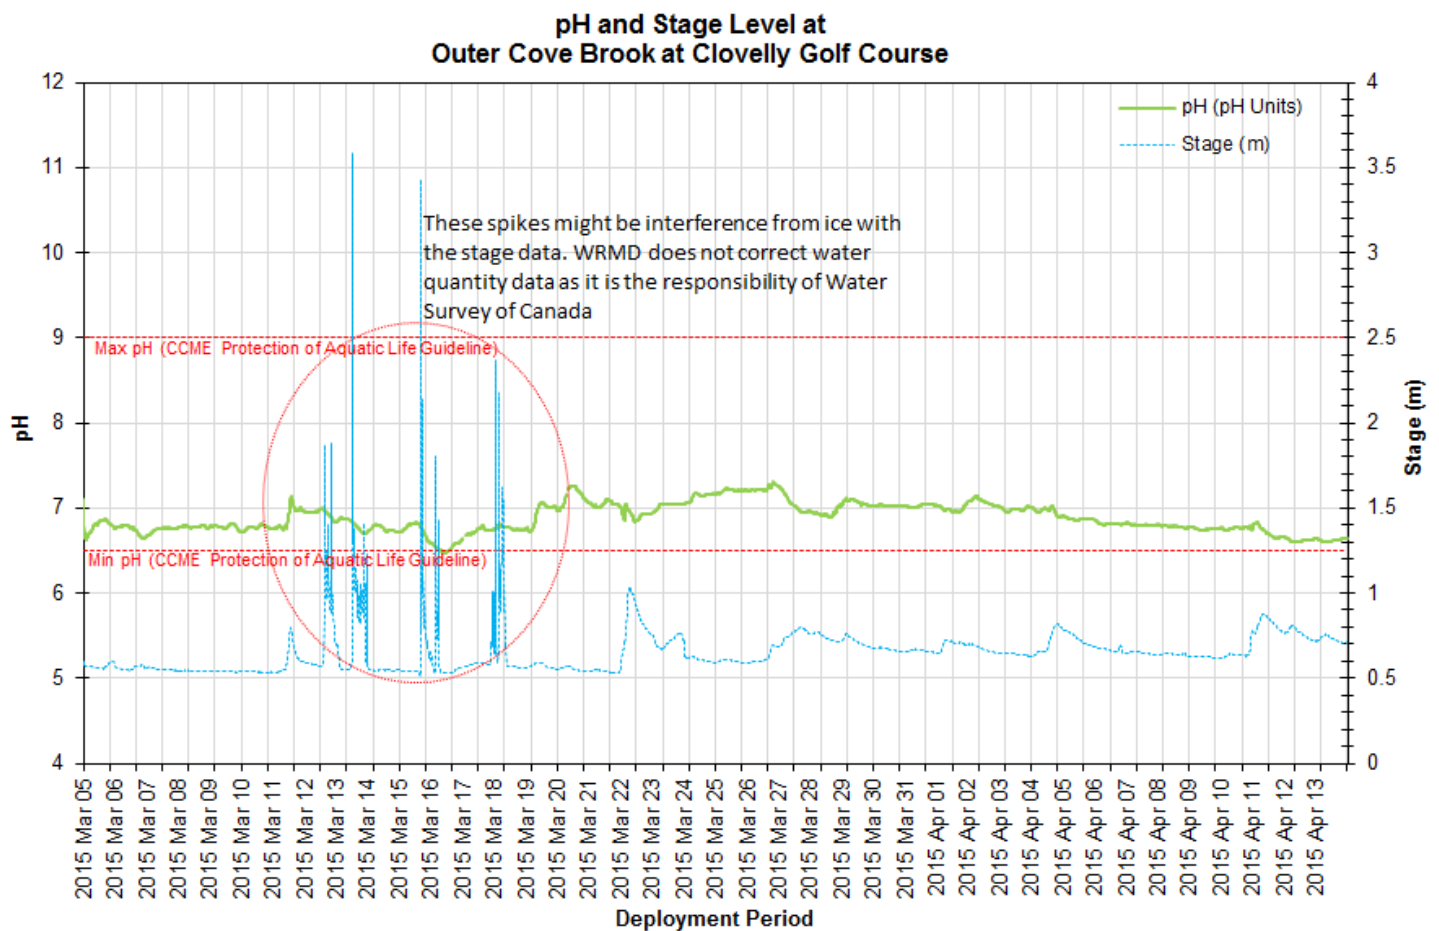

**Figure 9: pH (pH units) and stage level (m) values at Outer Cove Brook at Clovelly Golf Course.**


### Specific Conductivity & TDS

The conductivity levels were within  $466\mu\text{S}/\text{cm}$  and  $4130\mu\text{S}/\text{cm}$  during this deployment period. TDS ranged from  $0.2990\text{g}/\text{L}$  to  $2.6400\text{g}/\text{L}$  (Figure 10)

The conductivity probe measures the dissolved particles present in a water body, generally an increase in stage can indicate rainfall. Generally, rainfall saturates the brook and flushes the dissolved particles from the water column diluting the conductivity levels for a short period of time.

With the current icier temperatures (Appendix I), road salting has started on the roadways surrounding the brook. Road salting creates an opposite effect during high stage levels, the salt adds to the dissolved particles in the brook when it is flushed into the surrounding waterways and causes an increase in the conductivity values.

Total Dissolved Solids (TDS), is a parameter that the instrument calculates by an algorithm that utilizes the data from specific conductivity and water temperature to produce a TDS value and generally always mirrors specific conductivity.

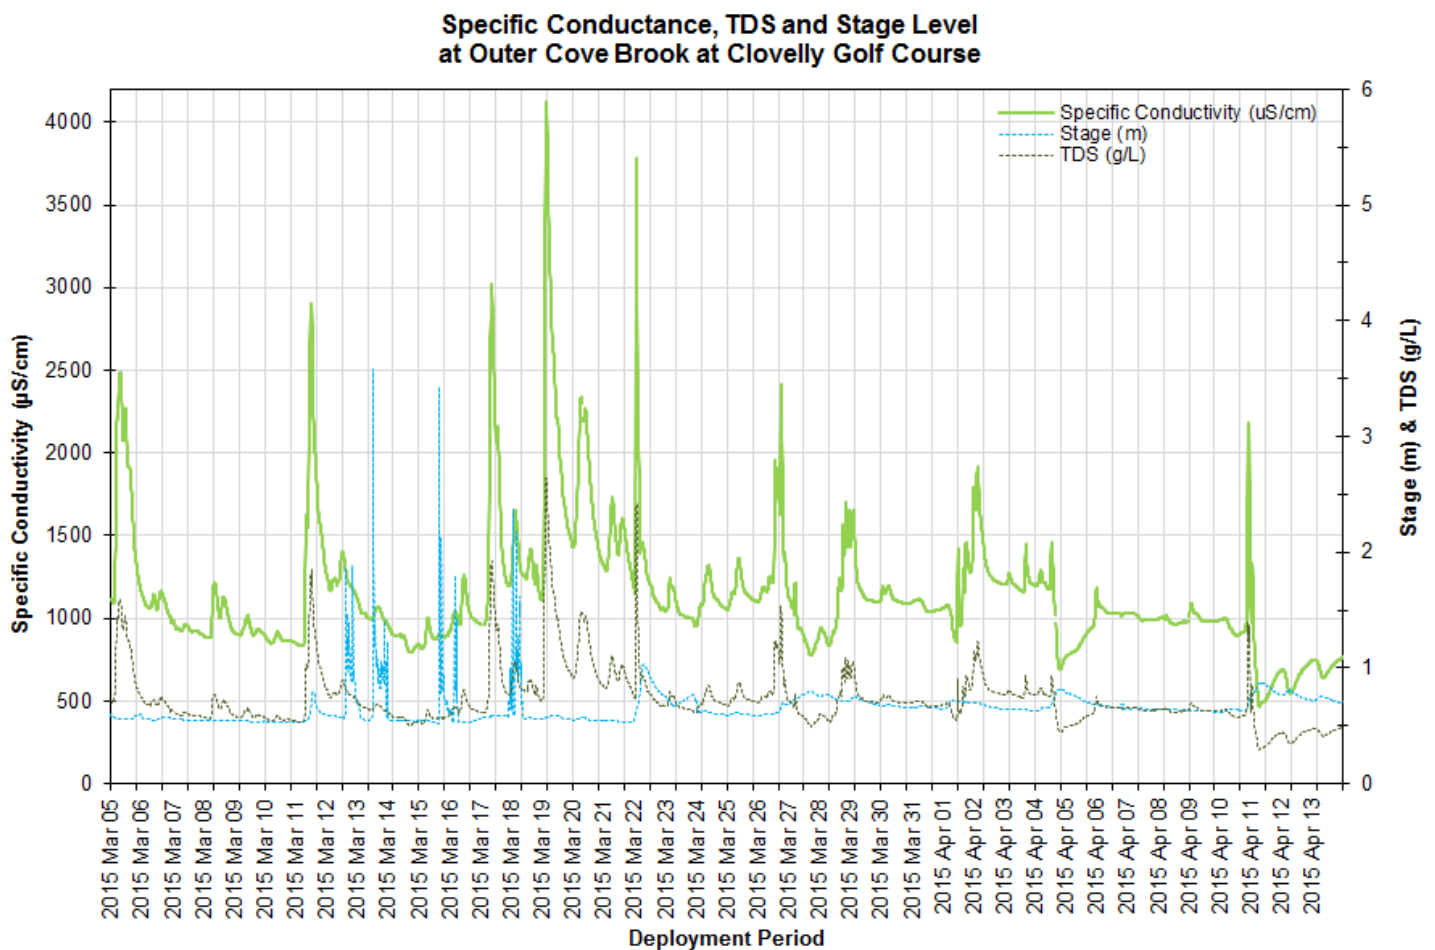

**Figure 10: Specific conductivity ( $\mu\text{S}/\text{cm}$ ) and stage (m) values at Outer Cove Brook at Clovelly Golf Course.**


## Dissolved Oxygen

The instrument measures dissolved oxygen (mg/L) then calculates percent saturation (% Sat).

The Dissolved Oxygen %Sat levels within this deployment period were within 60.7%Sat to 87.7%Sat. Dissolved Oxygen (mg/L) measured 8.80mg/L to 12.67mg/L (Figure 11).

It should be noted that the warmer water temperatures decrease the amount of dissolved oxygen a water body can hold. As water temperatures increase (most likely during the day) the water dissolved oxygen levels decrease with consumption from the aquatic organisms and vegetation present in the brook.

The large dissolved oxygen decrease (circled in red) was also evident on the dissolved oxygen graph for Outer Cove Brook below Airport for the same time frame. It is not clear what may have caused the dissolved oxygen levels at both stations to decrease at this time.

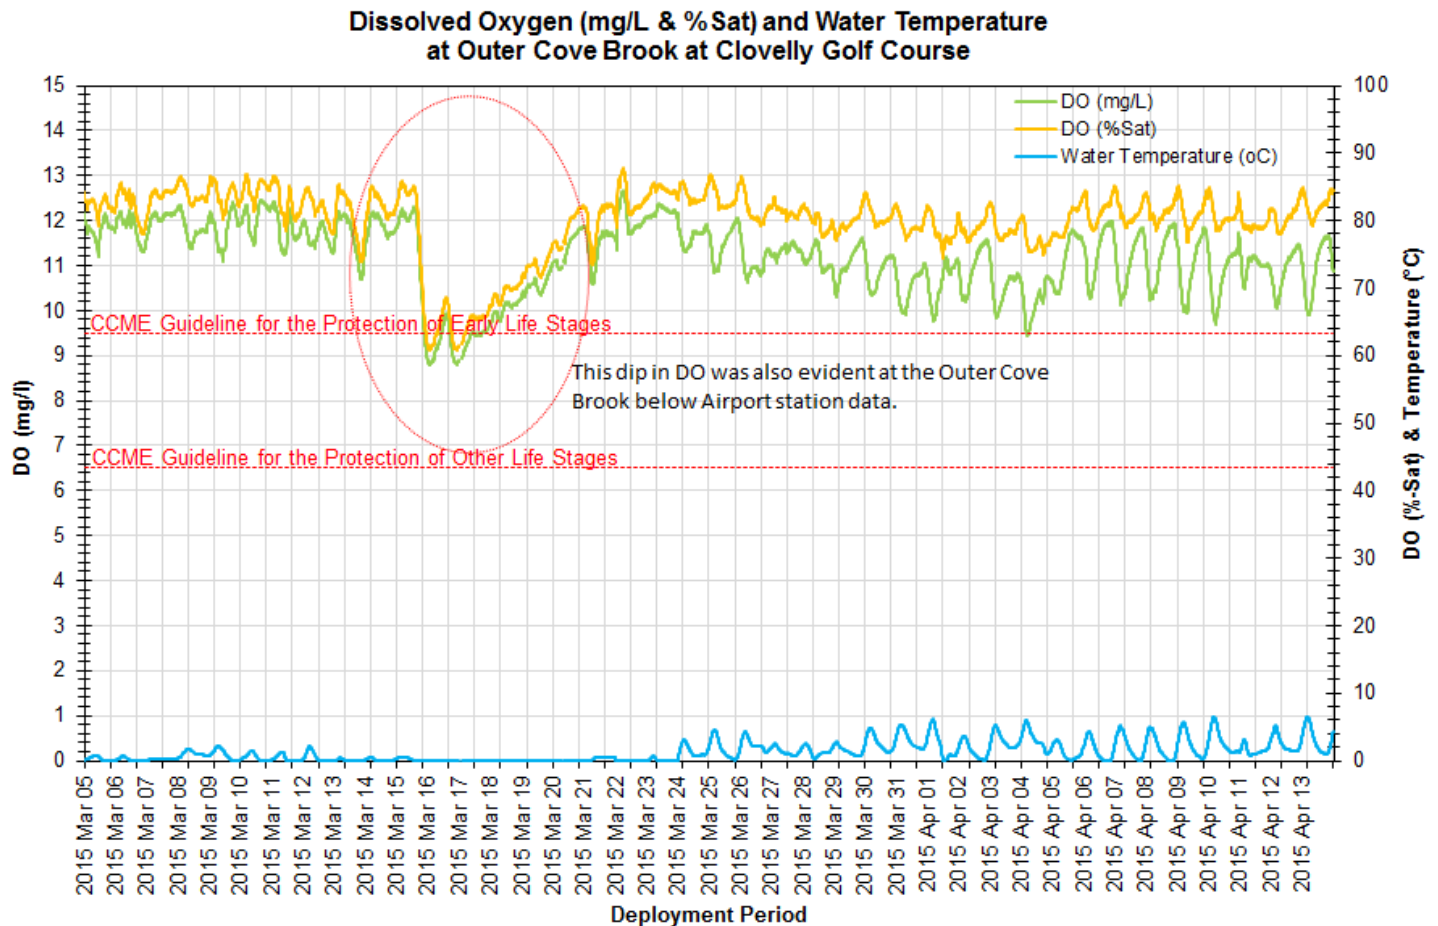

**Figure 11: Dissolved oxygen (mg/L & % sat) and water temperature (°C) values at Outer Cove Brook at Clovelly Golf Course.**


## **Turbidity**

Turbidity levels during the deployment period ranged from 0.0 NTU to 649.0 NTU (Figure 12), with a median of 1.8 NTU.

The turbidity sensor on the water quality instrument can read turbidity values between 0.0 NTU and 3000 NTU. However a turbidity reading of 3000 NTU is always identified as an error reading and during data grooming will be removed from the data set so to ensure it is not included in any statistical analysis.

As depicted on the graph there were several turbidity spikes during deployment. The majority of turbidity increases on the turbidity graph correspond with stage increases at the same time. The largest turbidity event on March 27<sup>th</sup> 2015 was likely a result of an increase in stage level. The total precipitation data indicates that there was 2 consecutive days of rainfall above 10 mm which likely contributed to the increased turbidity.

At removal, this instrument it was discovered to be fouled with a slime-like substance which caused the turbidity data being recorded to be inaccurate. Therefore the data at the end of deployment was removed.

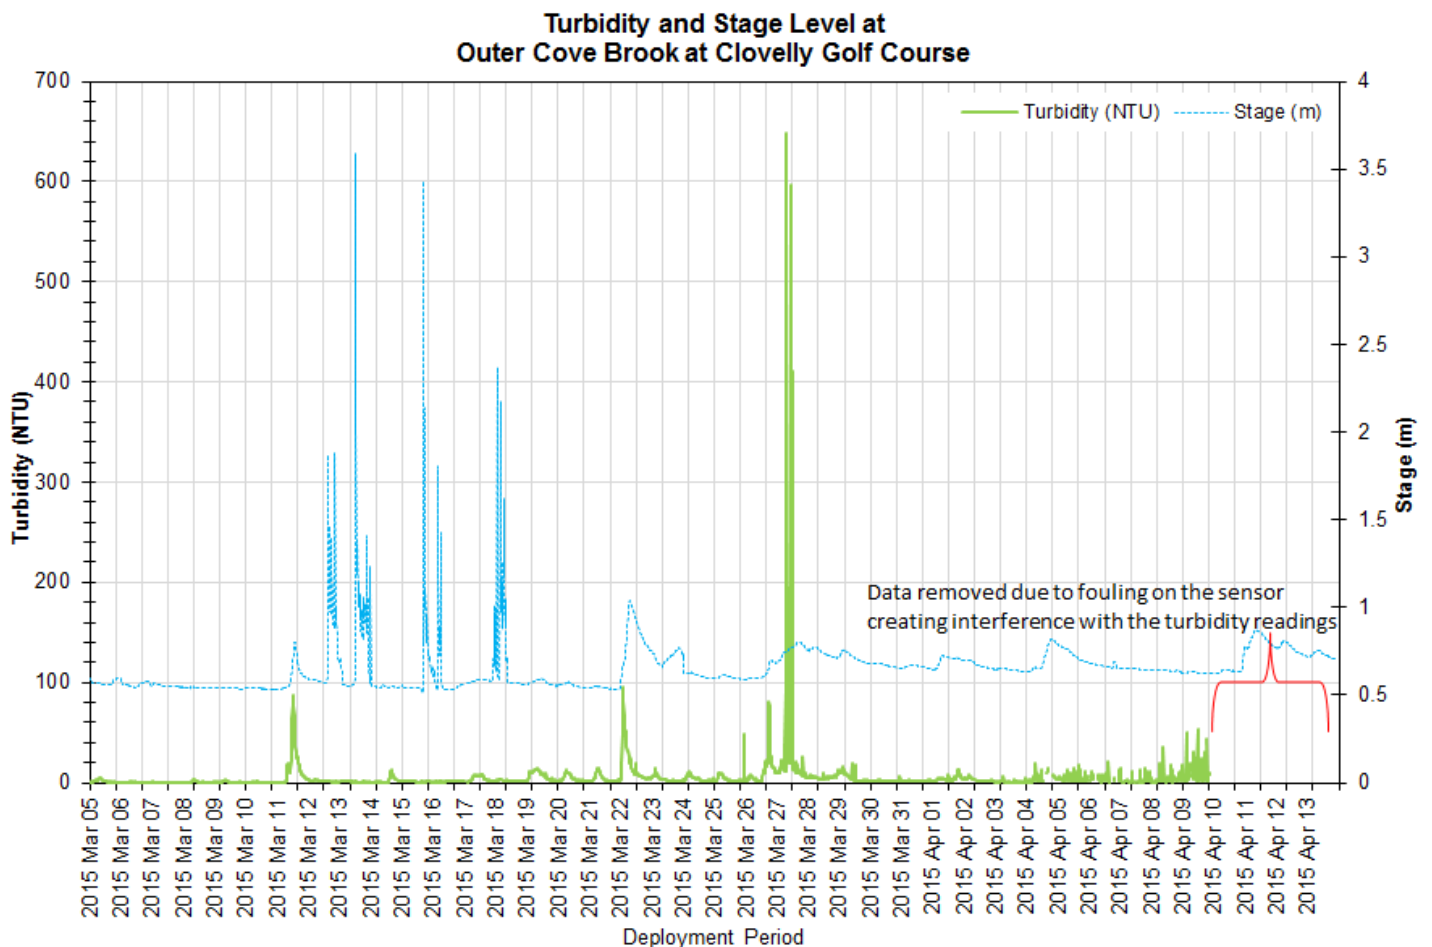

**Figure 12: Turbidity (NTU) and stage level (m) values at Outer Cove Brook at Clovelly Golf Course.**


## Stage, Stream Flow and Total Precipitation

Stage can be defined as the height or elevation of the stream's water surface above a reference elevation (sea level, gauge level). Stage is important to display as it provides an estimation of water level at the station and can explain some of the events that are occurring with other parameters (i.e. Specific Conductivity, DO, turbidity).

Stage levels during this deployment ranged from a minimum of 0.51m to a maximum of 3.59m. The precipitation ranged from a minimum of 0.0 mm a day to a maximum of 28.2 mm which was on March 16<sup>th</sup>, 2015. This rainfall event increased stage and stream flow at Outer Cove Brook at Clovelly Golf Course for a short period of time (Figure 13).

Precipitation data was obtained from Environment Canada's St. John's Airport weather station.

Please note the stage data graphed below is raw data that is published on WRMD web page. It has not been corrected for backwater effect. WSC is responsible for QA/QC of water quantity data. Corrected data can be obtained upon request to WSC.

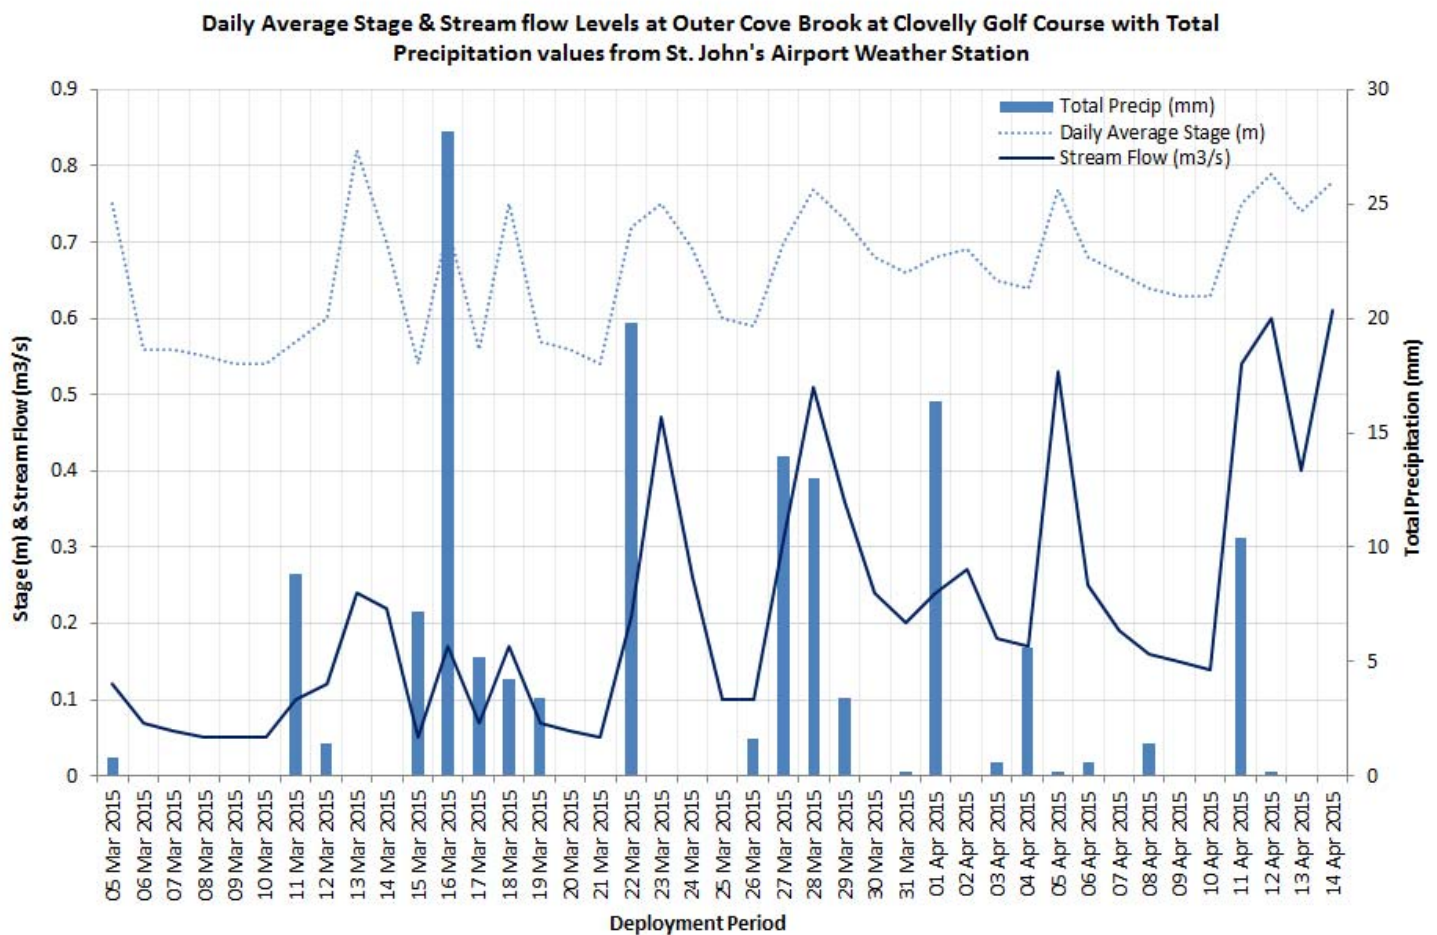

**Figure 13: Daily average stage & stream flow values at Outer Cove Brook at Clovelly Golf Course and daily total precipitation values (mm) from Environment Canada's Weather Station at St. John's International Airport.**



## Conclusion

- This brook flows through significant developed areas, including residential zones, golf courses and within the boundaries of heavily used road ways, which can influence the water quality parameters in the areas of turbidity increases or conductivity increases when runoff from residential areas is a factor. The conductivity data displays potential runoff influences throughout the deployment as road salting continued with the colder winter weather. The peaks in conductivity, turbidity and pH are a result of road salt runoff when the air temperature was below 0°C.
- As ambient air temperatures increase with slightly warmer temperatures it should reflect in the water temperature. In turn, the water temperature of the brook directly affects the amount of dissolved oxygen that is present in the waterbody.
- The dissolved oxygen at Outer Cove Brook at Clovelly Golf Course displays the significant dip starting on March 16, 2015 this decrease is also evident on the Airport station dissolved oxygen graph. It is not clear on the cause of the dip however there was significant rainfall (28.2 mm) and a stage increase recorded at Outer Cove Brook at Clovelly Golf Course for the same time frame.

## APPENDIX I

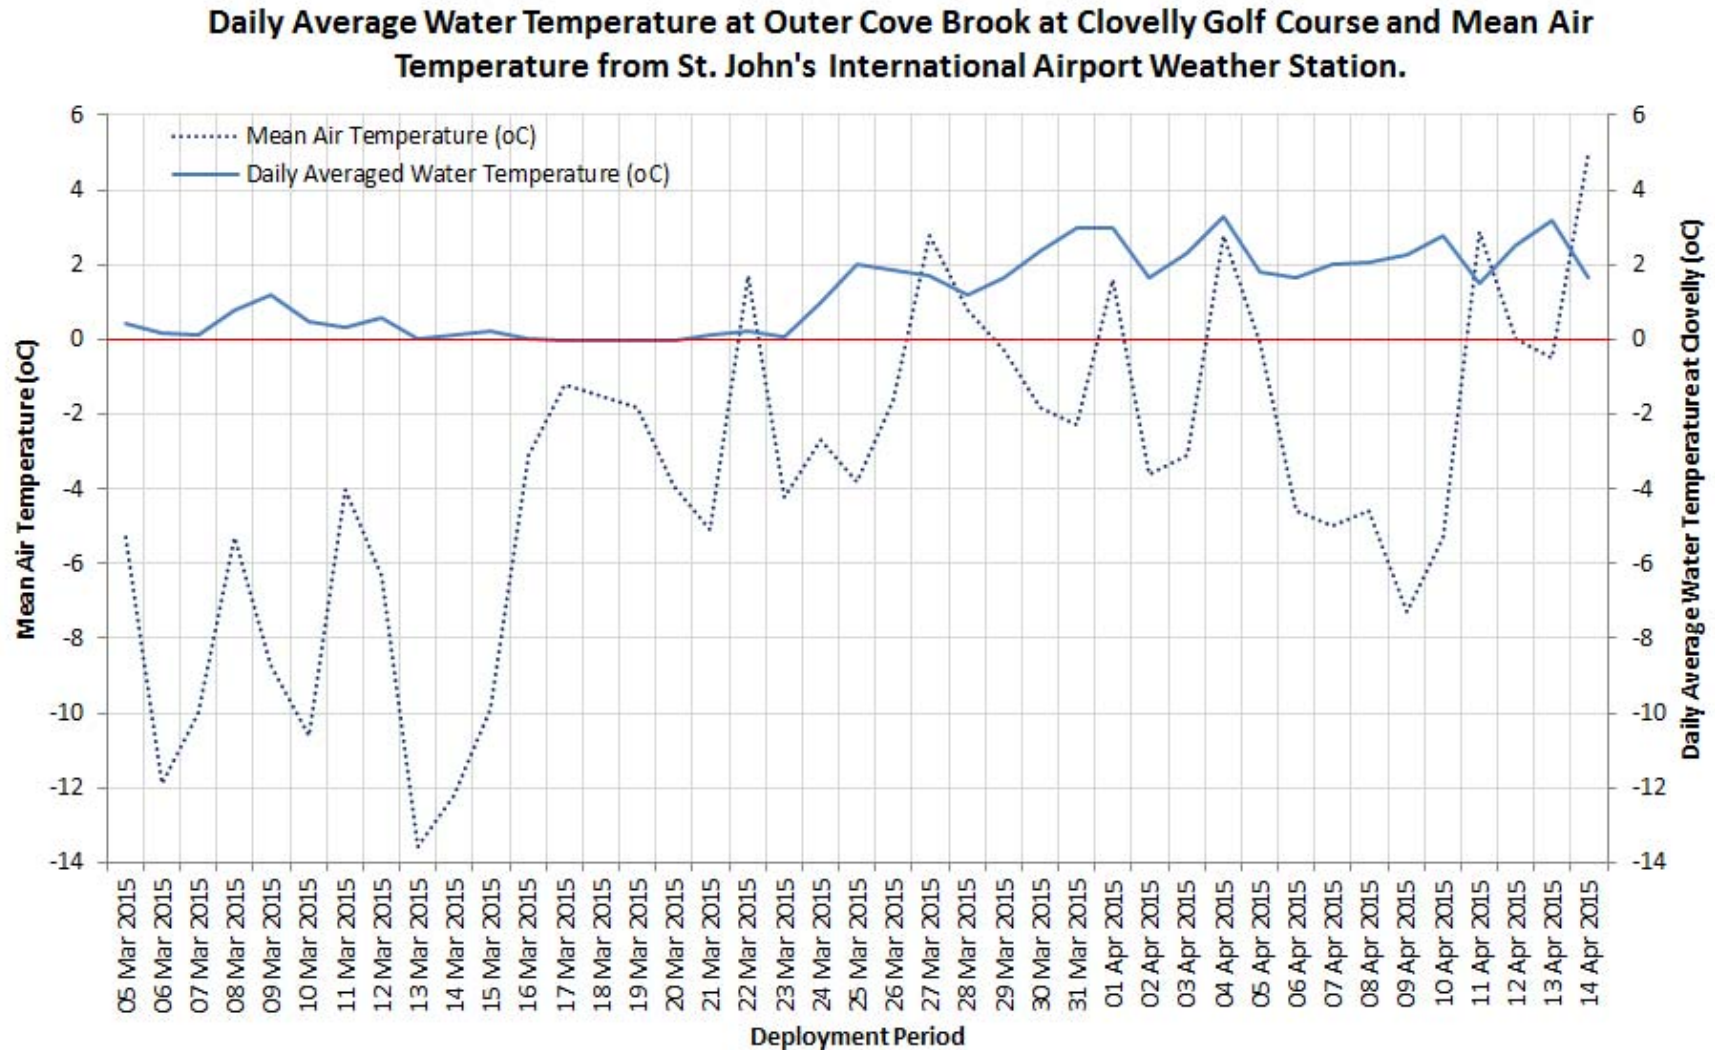


Figure 14: Daily average water temperature values from Outer Cove Brook at Clovelly Golf Course and air temperature values from Environment Canada's Weather Station at St. John's International Airport.

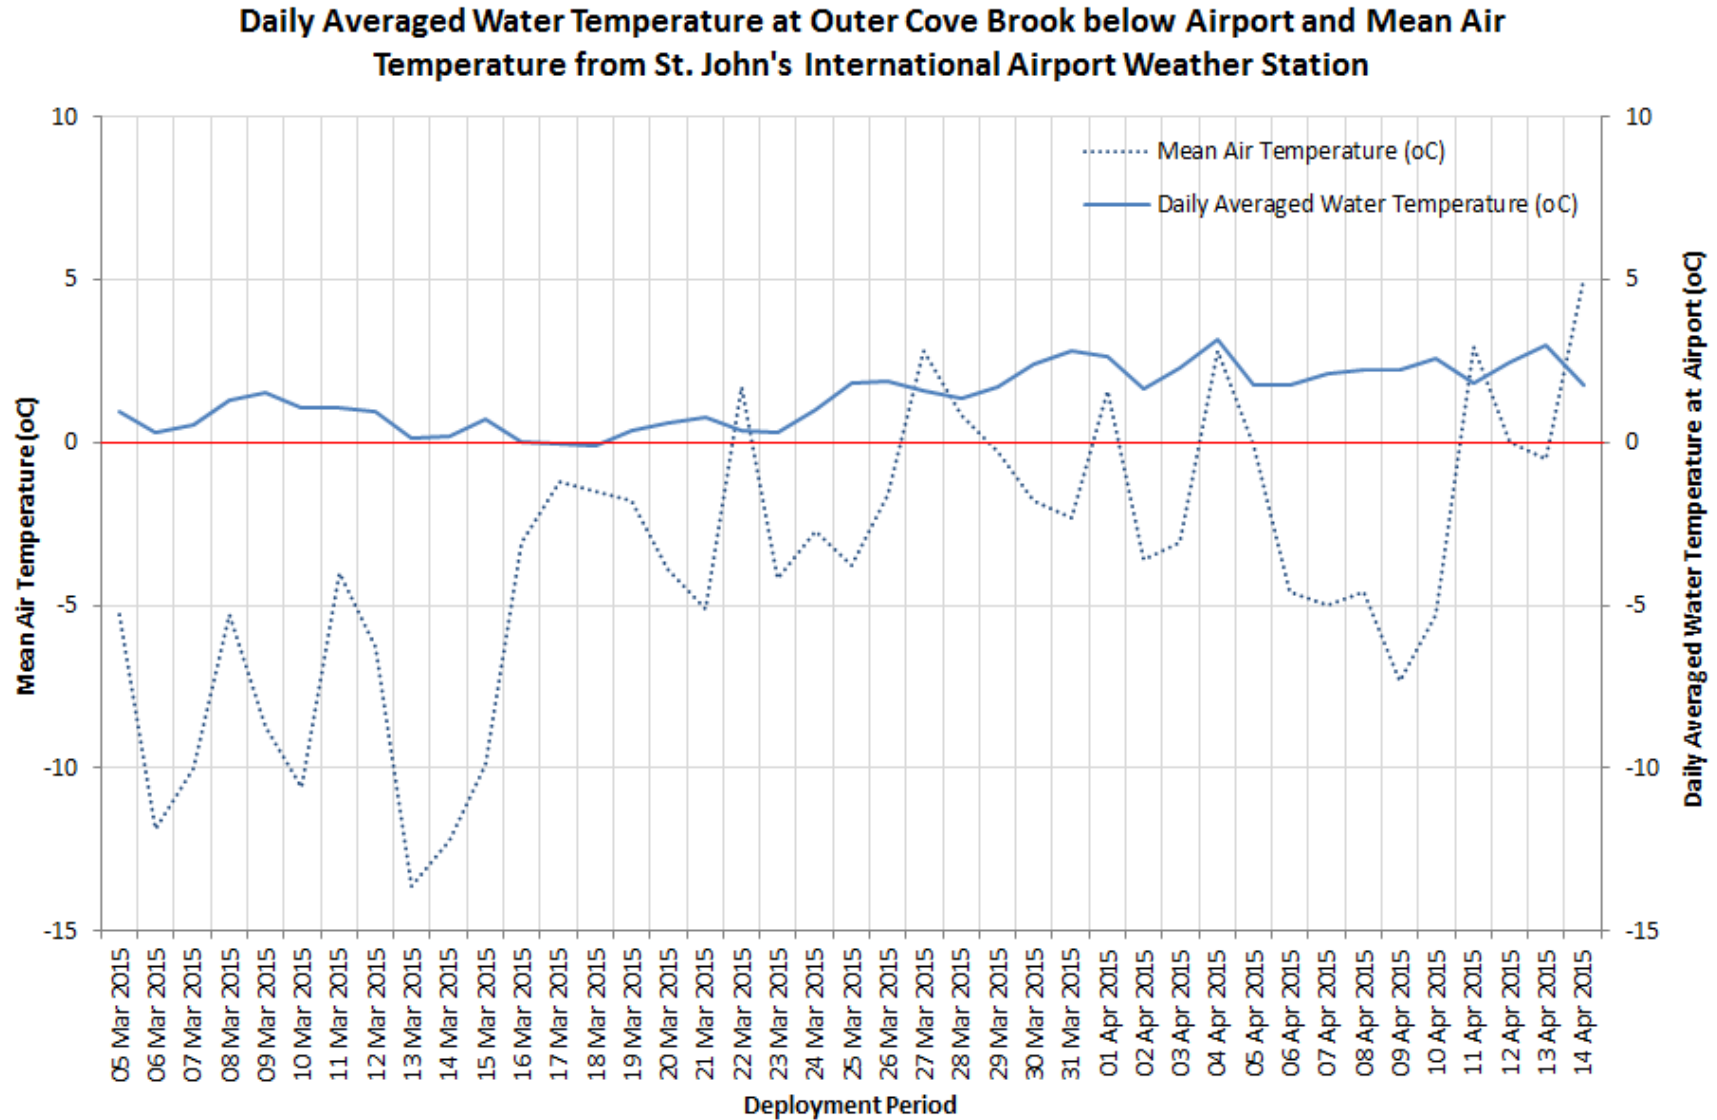


Figure 15: Daily average water temperature values from Outer Cove Brook below Airport and air temperature values from Environment Canada's Weather Station at St. John's International Airport.

## APPENDIX II



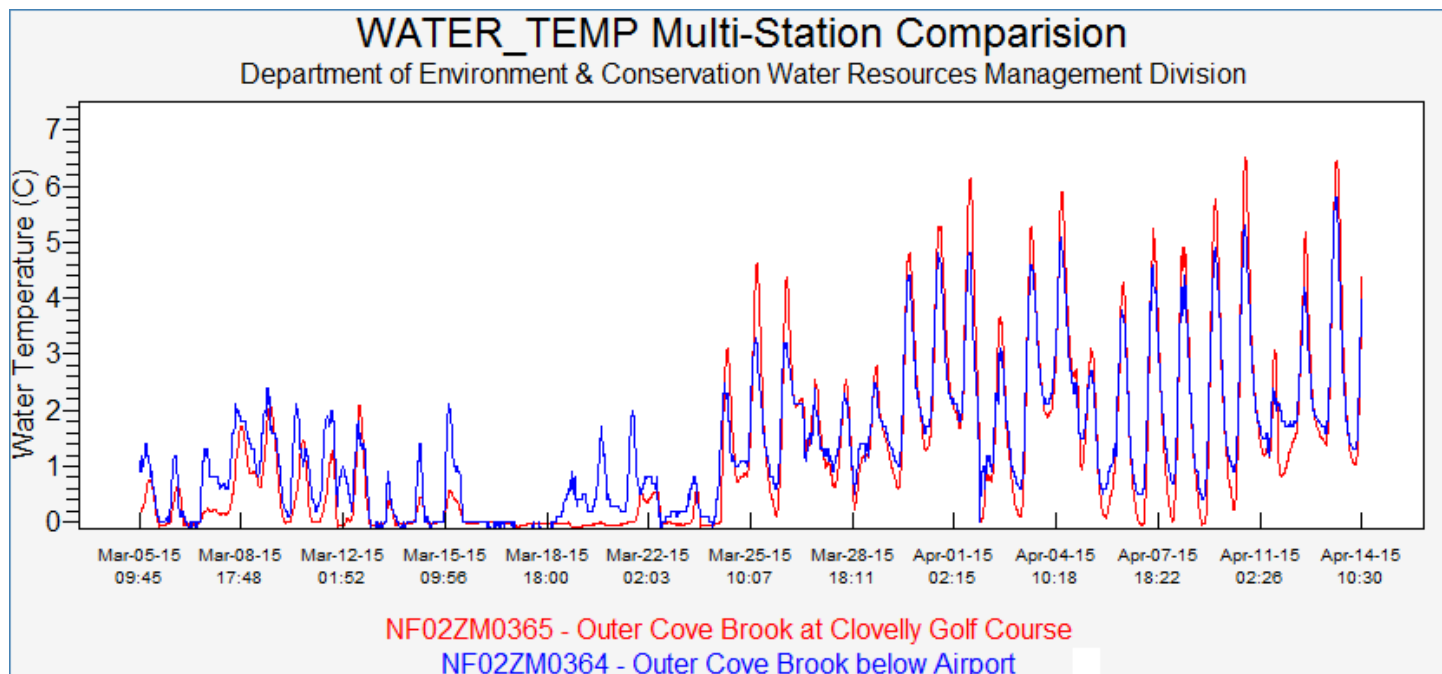


Figure 16: Comparison Water Temperature at the Outer Cove Brook Stations

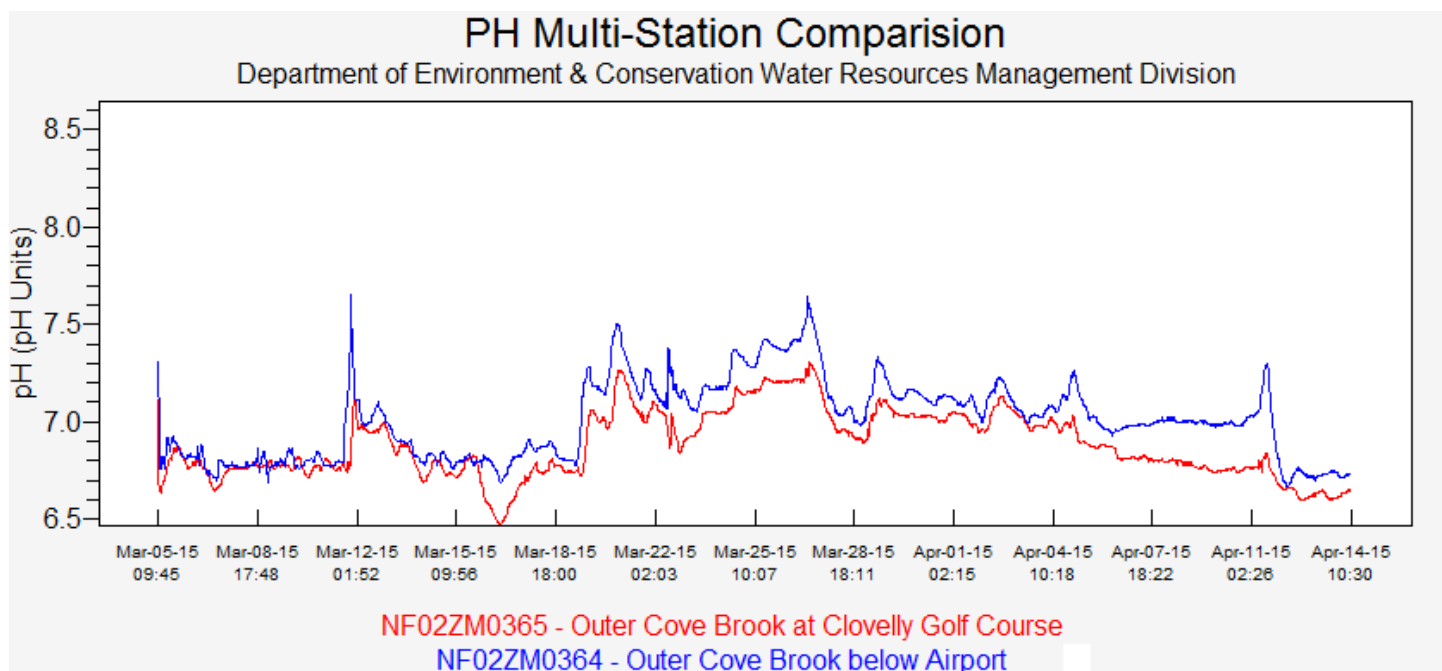


Figure 17: Comparison of pH units at the Outer Cove Brook Stations

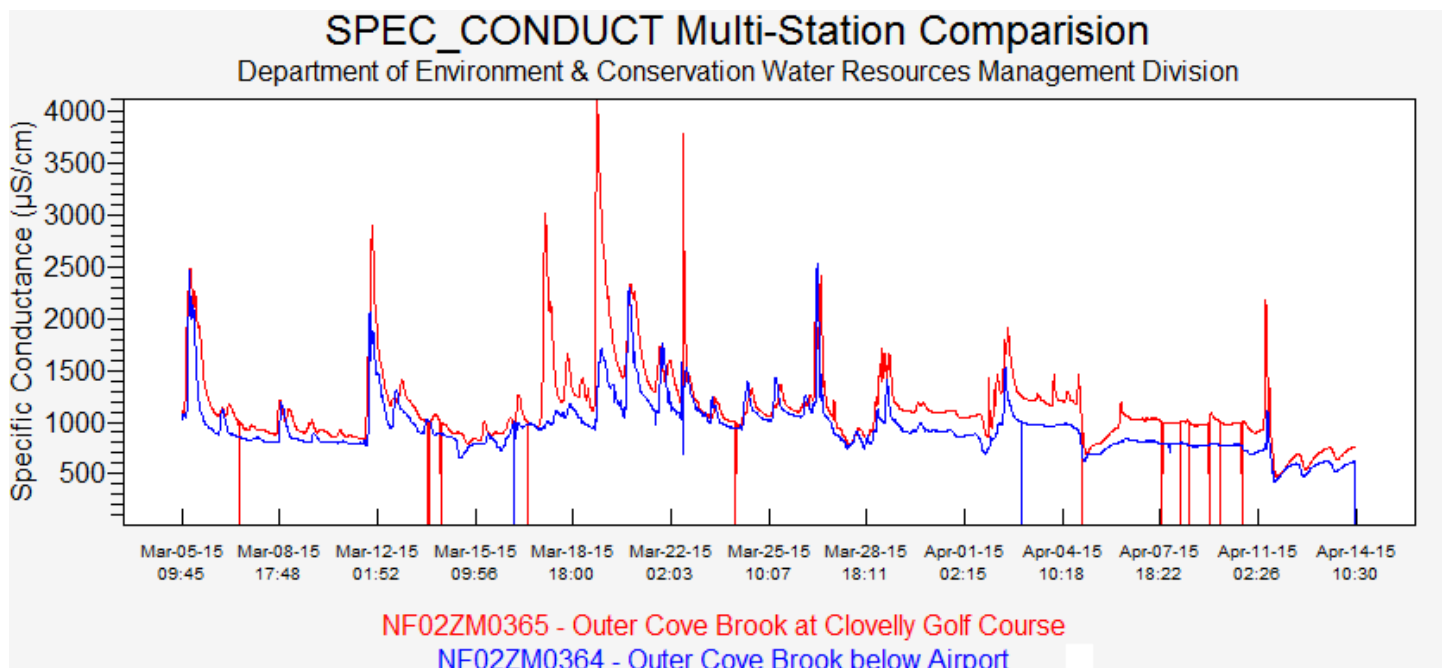


Figure 18: Comparison Specific Conductivity at the Outer Cove Brook Stations

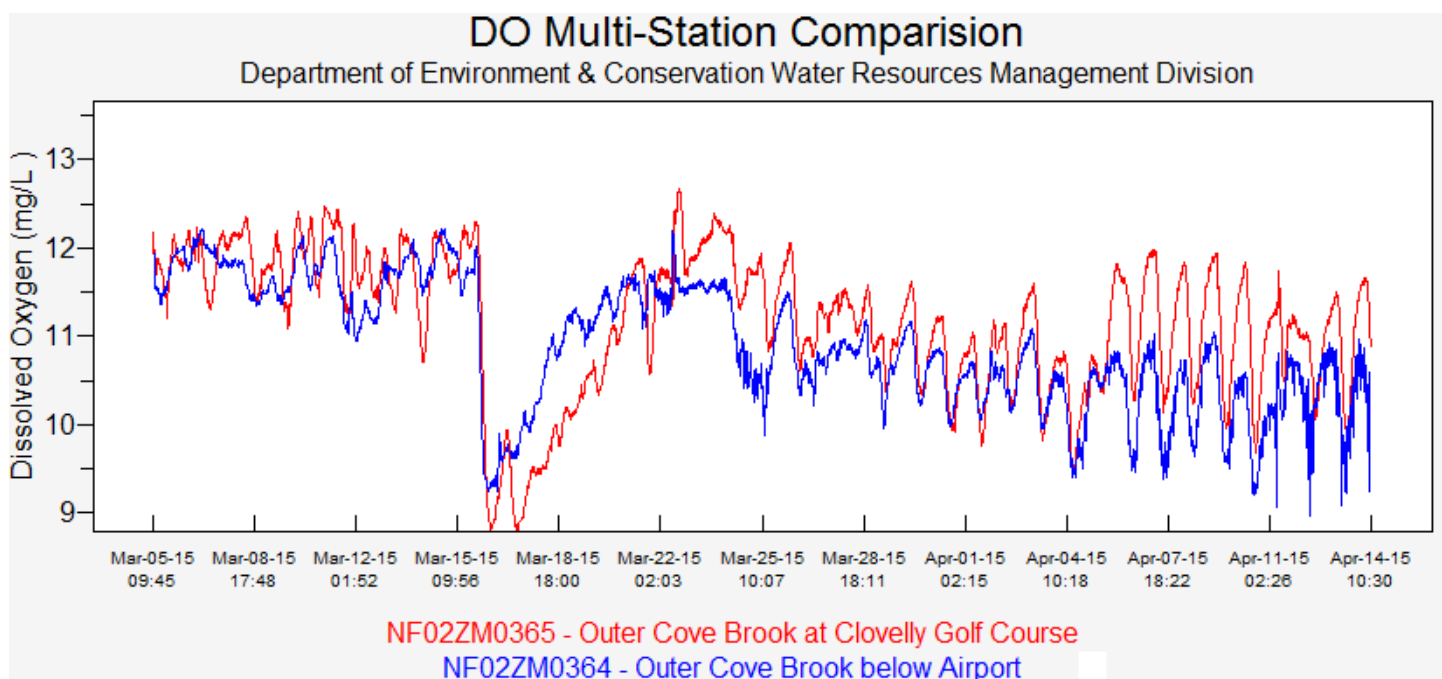


Figure 19: Comparison of Dissolved Oxygen ( $\text{mg}/\text{L}$ ) at the Outer Cove Brook Station

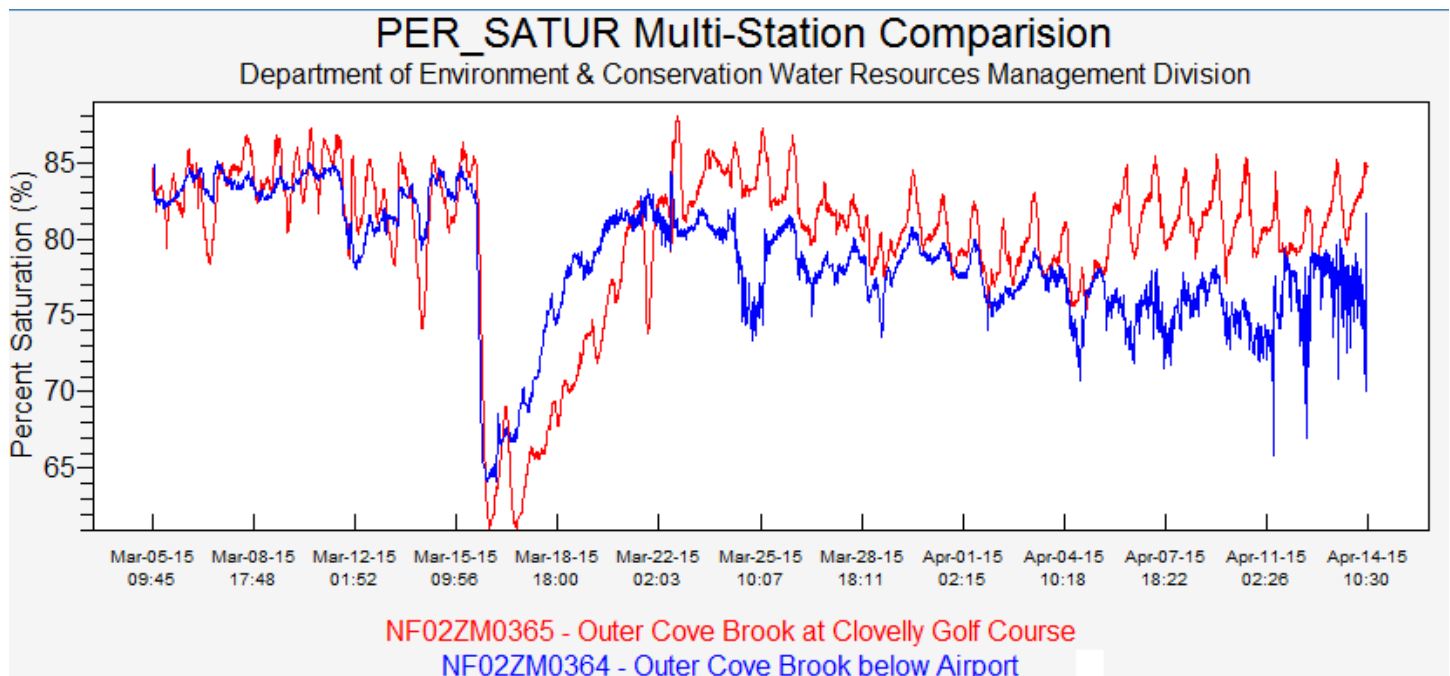


Figure 20: Comparison of Dissolved Oxygen (%Sat) of the Outer Cove Brook stations

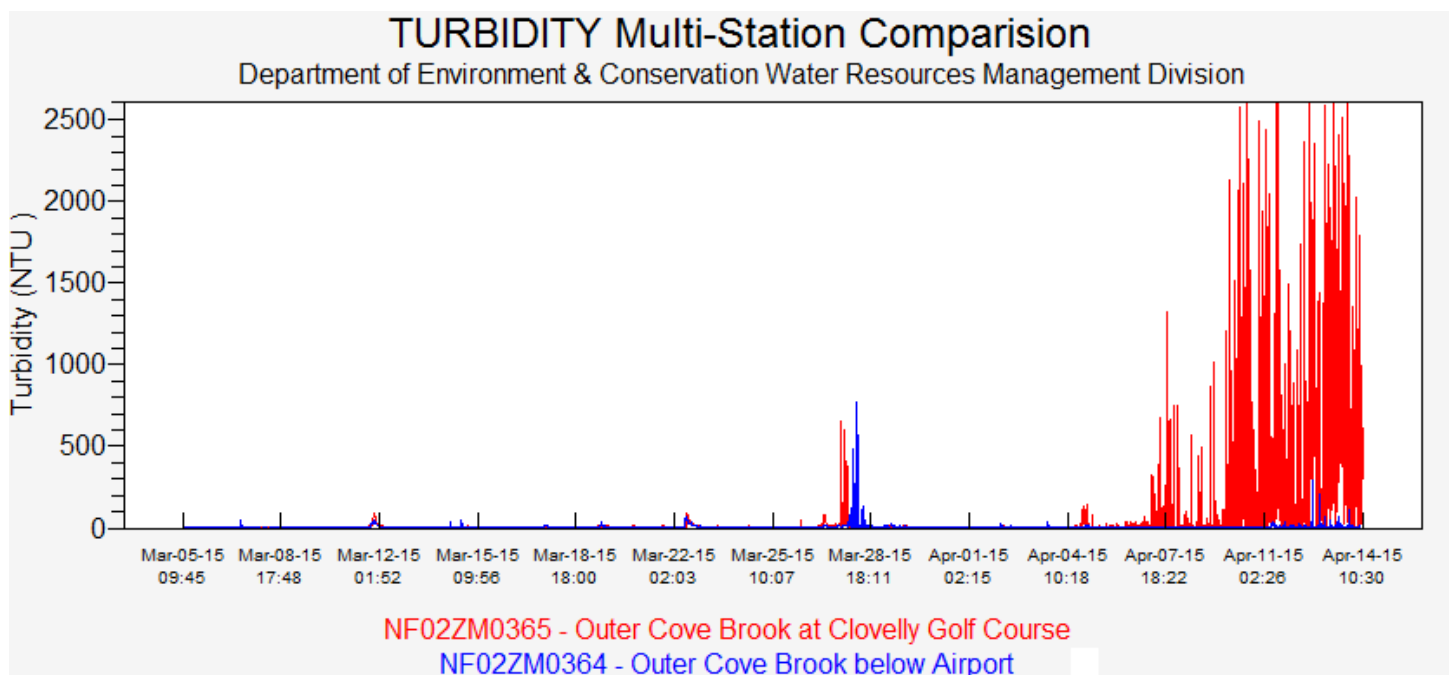


Figure 21: Comparison of Turbidity at the Outer Cove Brook stations

\*Please note: Turbidity data that was removed for the report is evident in the graph above, this data does not represent the water body.